TERMINALS

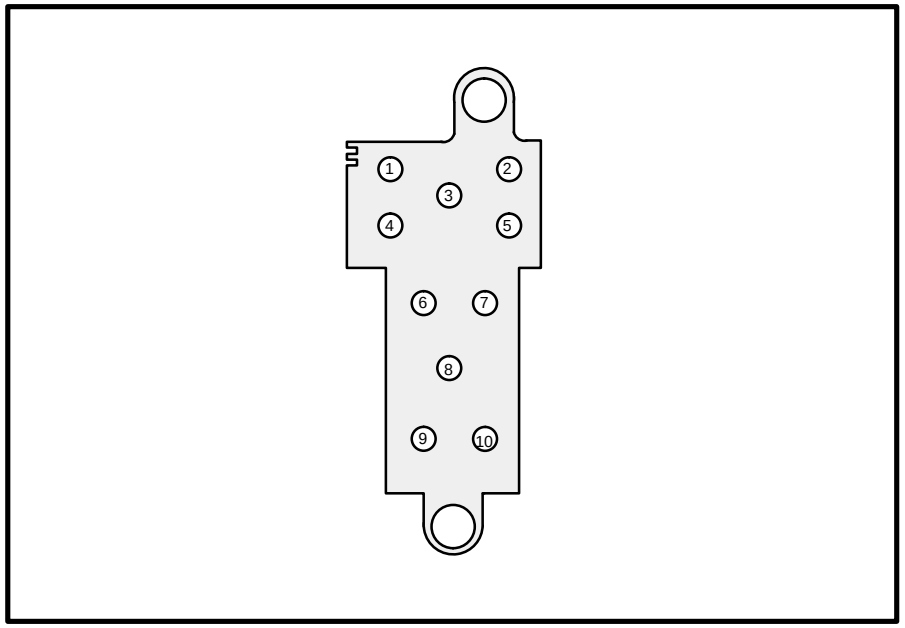

SCHEMATIC

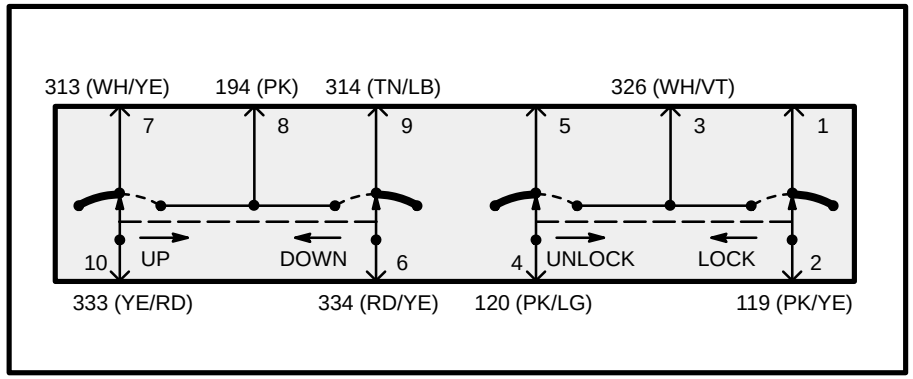

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	8 and 7 8 and 9	Window Switch (All Positions)	Open Circuit
	7 and 10 9 and 6	Window Switch (At Rest)	Closed Circuit
	3 and 4 3 and 2	Door Lock Switch (At Rest)	Open Circuit
Window Circuit	8 and 10 9 and 6	Up	Closed Circuit
	8 and 6 10 and 7	Down	Closed Circuit
Door Lock Switch	3 and 2 5 and 4	Lock	Closed Circuit
	3 and 4 1 and 2	Unlock	Closed Circuit