Multifunction Switch, Wiper/Washer Portion

Schematic

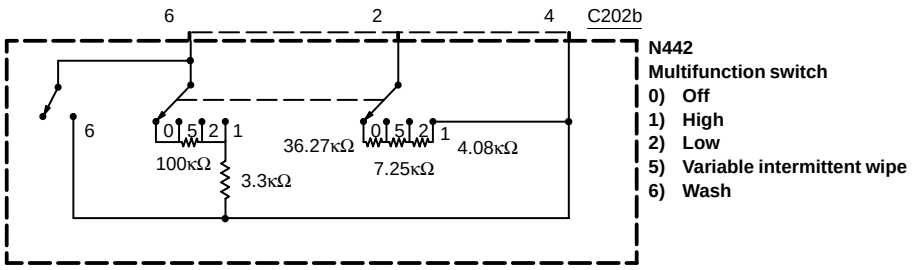

Terminals

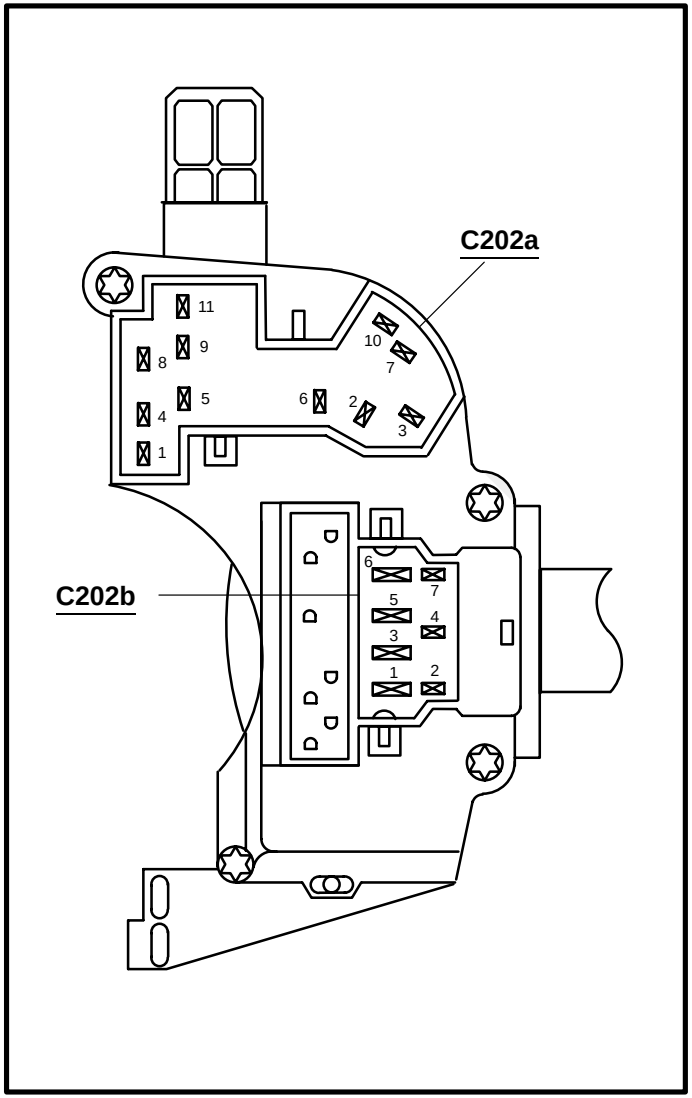

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	6 and 4	Wiper switch Off, Washer switch depressed	Closed circuit
		Wiper switch Off, Washer switch normal	103kΩ ± 10%
Wiper switch circuit	2 and 4	Off	47.6kΩ ± 10%
		Intermittent	11.33Ω ± 5%
		Low	4.08Ω ± 5%
		High	Closed circuit
Intermittent wiper circuit	6 and 4	Intermittent and Off	Rotate control toward Off; ohmmeter will show smoothly increasing resistance from 3.3kOhm minimum to 103.3kOhm maximum.
		Low and High	3.3kΩ ± 10%