Multifunction Switch, Lamp Portion

Schematic

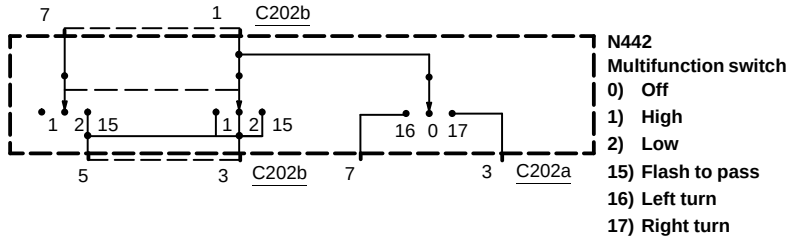

Terminals

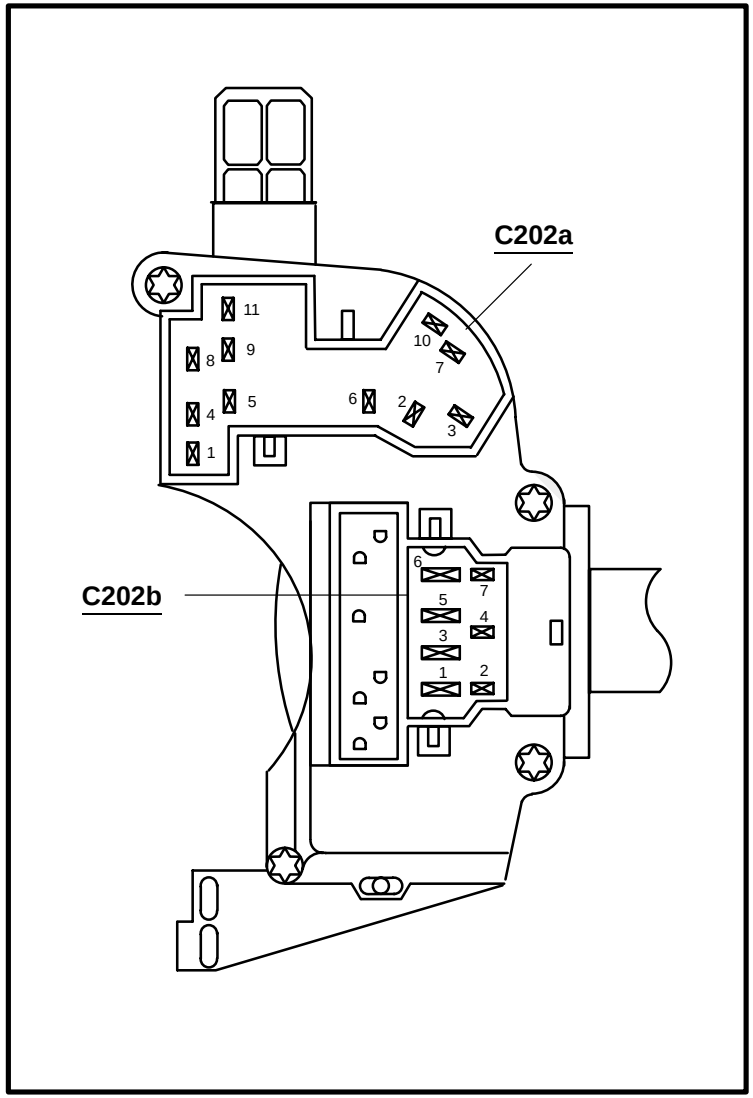

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
High beam	1 and 5	High beam	Closed circuit
		Flash–to–pass	Open circuit
		Low beam	Open circuit
Low beam/Flash–to–pass	1 and 3	High beam	Open circuit
		Flash–to–pass	Closed circuit
		Low beam	Closed circuit
	7 and 5	High beam	Open circuit
		Flash–to–pass	Closed circuit
		Low beam	Open circuit
Cornering lamp	1 and 7	Left turn	Closed circuit
		Off	Open circuit
	1 and 3	Right turn	Closed circuit
		Off	Open circuit