149-9 COMPONENT TESTING: MULTIFUNCTION SWITCH

SCHEMATIC

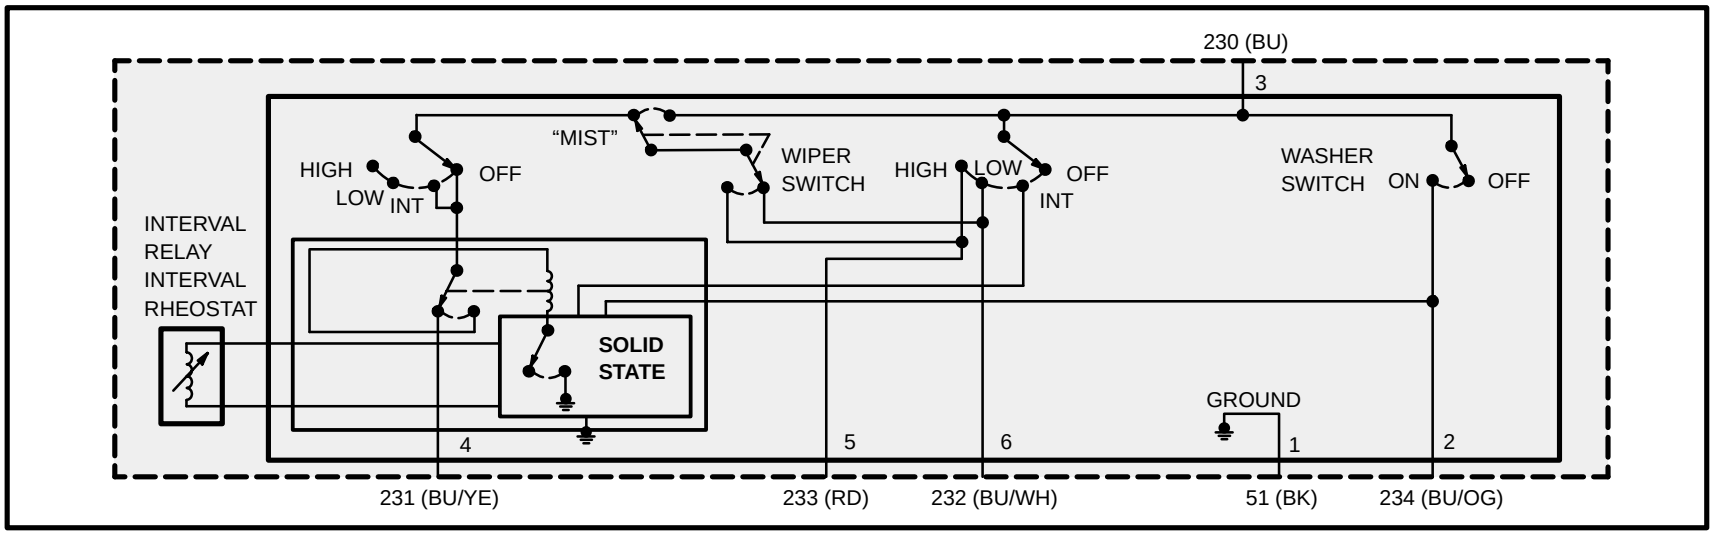

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Wiper Speed "LOW"	3 and 6	OFF Int LOW HIGH	Open Circuit Open Circuit Closed Circuit Open Circuit
Wiper Speed "HIGH"	3 and 5	OFF Int LOW HIGH	Open Circuit Open Circuit Open Circuit Closed Circuit
Park Switch Circuit	6 and 4	OFF Int LOW HIGH	Closed Circuit Closed Circuit Open Circuit Open Circuit
"MIST" Circuit	4 and 5	Mist Switch On Mist Switch Off	Closed Circuit Open Circuit