Schematic

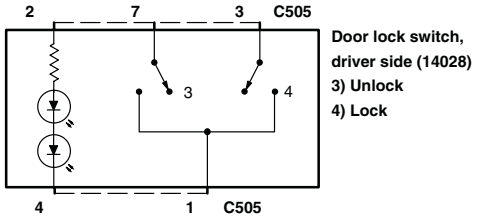

Terminals

C505

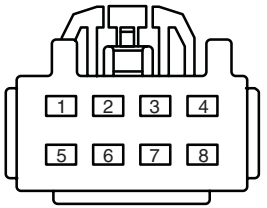

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Door lock switch	3 and 1	Lock	Closed circuit
		Unlock	Open circuit
		Neutral	Open circuit
	7 and 1	Lock	Open circuit
		Unlock	Closed circuit
		Neutral	Open circuit