Component Testing – Ignition switch

SCHEMATIC

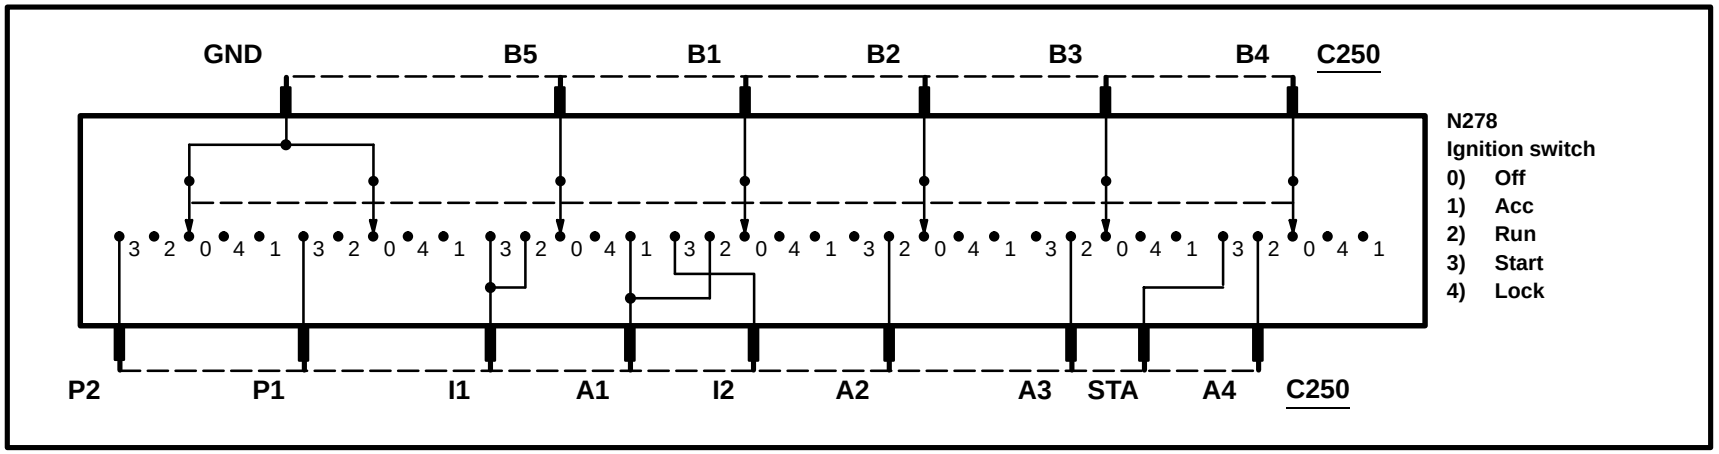

TERMINAL LOCATIONS

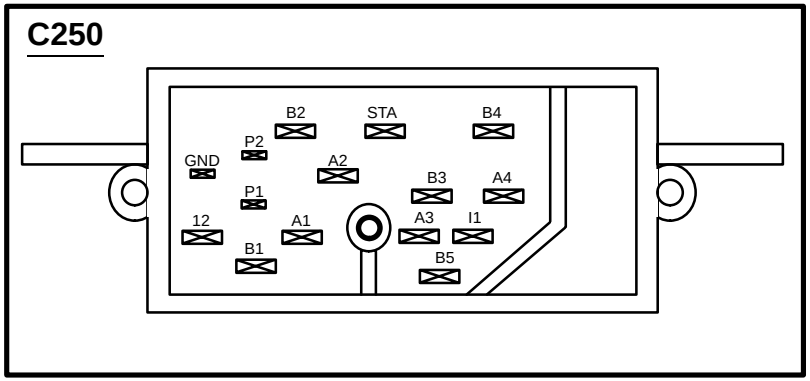

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Run Power Circuit	B2 and A2 B3 and A3 B4 and A4	Off/Lock	Open Circuit
		Acc	Open Circuit
		Run	Closed Circuit
		Start	Open Circuit
Run/Start Power Circuit	B5 and I1	Off/Lock	Open Circuit
		Acc	Open Circuit
		Run	Closed Circuit
		Start	Closed Circuit
Run/Acc Power Circuit	B1 and A1	Off/Lock	Open Circuit
		Acc	Closed Circuit
		Run	Closed Circuit
		Start	Open Circuit
Start Power Circuit	GND and P2 GND and P1 B1 and I2 B4 and STA	Off/Lock	Open Circuit
		Acc	Open Circuit
		Run	Open Circuit
		Start	Closed Circuit