Power window switch, RH side front

Schematic

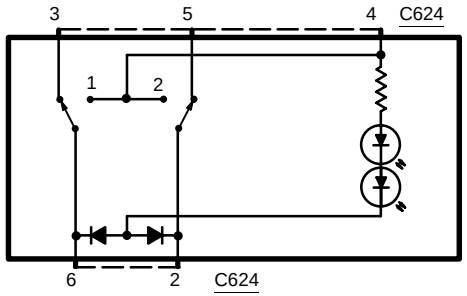

Power window switch, RH side front

1) Up

2) Down

Terminals

C624

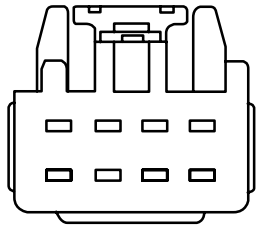

F08289

Component testing procedure

Circuit to test	Connect self–powered test light or ohm-meter to terminals	Move switch to these positions	A good switch will indicate
Up Switch Circuit	4 and 6	Up	Closed circuit
	5 and 2	Up	Open circuit
Down Switch Circuit	4 and 2	Down	Closed circuit
	3 and 6	Down	Open circuit