Schematic

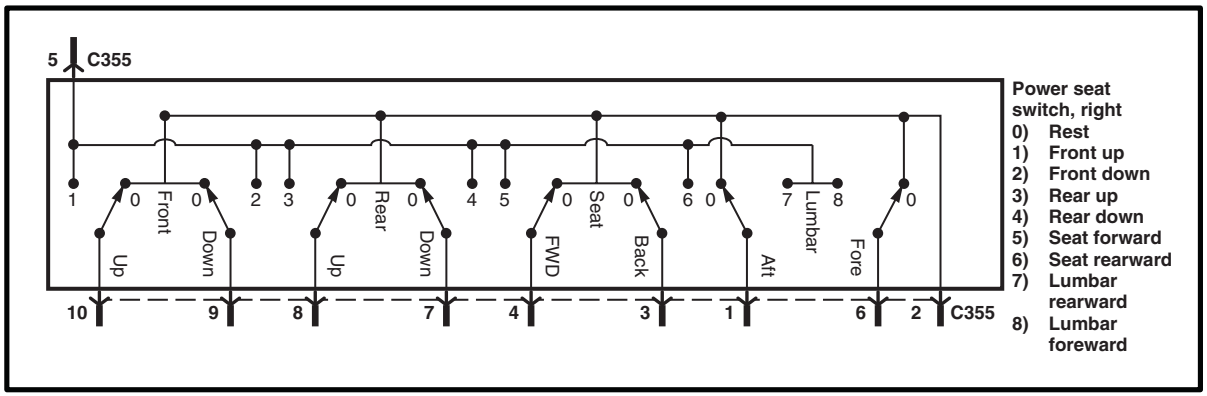

Terminals

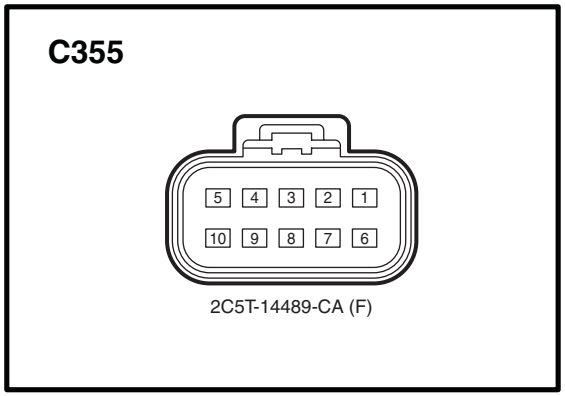

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Forward/Rearward circuit	4 and 5 4 and 2	Forward	Closed circuit
		Rearward	Closed circuit
	3 and 2 3 and 5	Forward	Closed circuit
		Rearward	Closed circuit
Front up/down circuit	10 and 5 10 and 2	Up	Closed circuit
		Down	Closed circuit
	9 and 2 9 and 5	Up	Closed circuit
		Down	Closed circuit
Rear up/down circuit	8 and 5 8 and 2	Up	Closed circuit
		Down	Closed circuit
	7 and 2 7 and 5	Up	Closed circuit
		Down	Closed circuit