† Automatic

C141 (BU)

†7C078
15525

Heated Oxygen Sensor
(HO2S) #22 (9G444)

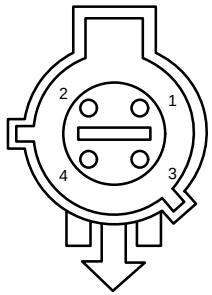

F04251

Pin	Circuit	Circuit function
1	391 (RD/YE)	Voltage supplied in Start and Run (overload protected)
2	390 (TN/YE)	Heated Oxygen Sensor (HO2S) #22 (9G444), heater
3	359 (GY/RD)	signal, return
4	393 (VT/LG)	Heated Oxygen Sensor (HO2S) #22 (9G444), input

† Automatic

C142 (VT)

†7C078
15525

Heated Oxygen Sensor
(HO2S) #12 (9G444)

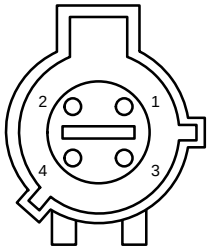

F04303

Pin	Circuit	Circuit function
1	391 (RD/YE)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

* 3.8L
‡ Cobra

C144 (GY)

12A581

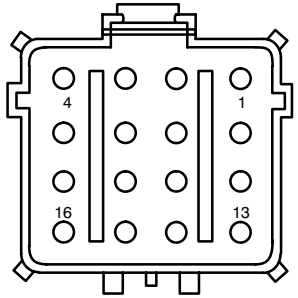

F16067

(1) 33 (WH/PK)
‡32 (RD/LB)
(2) 494 (TN/LG)
(3) 38 (BK/OG)
(4) 198 (DG/OG)
(5) 32 (RD/LB)
(6) 914 (TN/OG)
(7) *198 (DG/OG)
478 (TN/OG)
(8) 511 (LG)
(9) 492 (BN)
(10) 239 (WH/OG)
(11) 511 (LG)
‡17 (WH)
(12) –
(13) 915 (PK/LB)
(14) 1059 (LB/OG)
‡31 (WH/RD)
(15) 514 (YE/RD)
(16) 516 (YE/BK)

14290

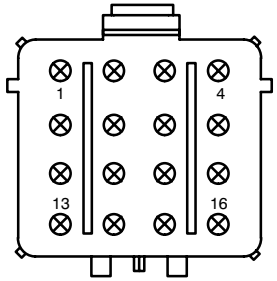

F16036

(1) 33 (WH/PK)
(2) 494 (TN/LG)
(3) 38 (BK/OG)
(4) 198 (DG/OG)
(5) 32 (RD/LB)
(6) 914 (TN/OG)
(7) *198 (DG/OG)
478 (TN/OG)
(8) 511 (LG)
(9) 492 (BN)
(10) 239 (WH/OG)
(11) 511 (LG)
‡17 (WH)
(12) –
(13) 915 (PK/LB)
(14) 1059 (LB/OG)
‡31 (WH/RD)
(15) 514 (YE/RD)
(16) 516 (YE/BK)