TERMINALS

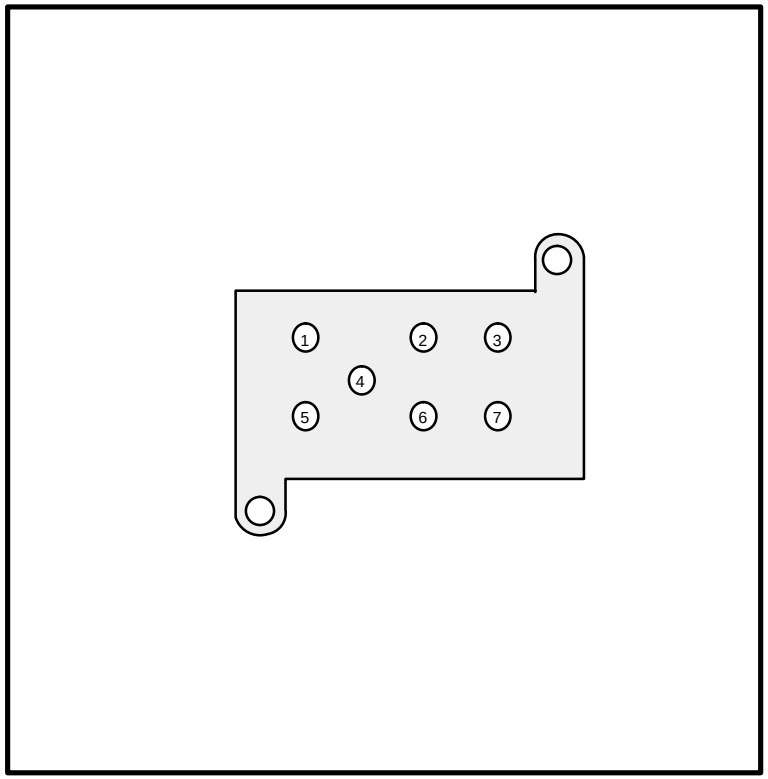

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Right Rear Window	4 and 5 2 and 4	Down Up	Closed Circuit Closed Circuit
Master Window Door Lock Control	5 and 6 1 and 2	Neutral Down Neutral Up	Closed Circuit Open Circuit Closed Circuit Open Circuit
Switch Illumination	3 and 7	–	Closed Circuit
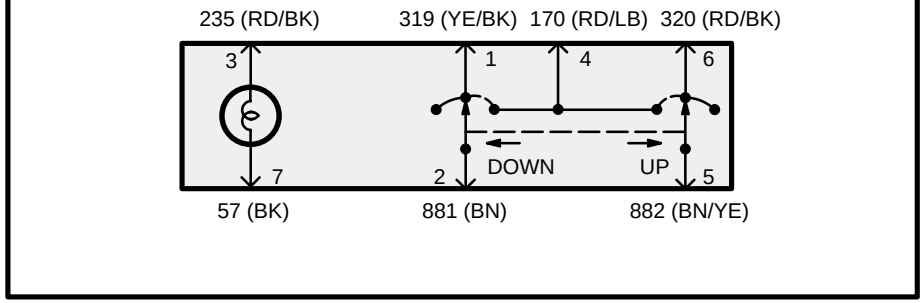
SCHEMATIC