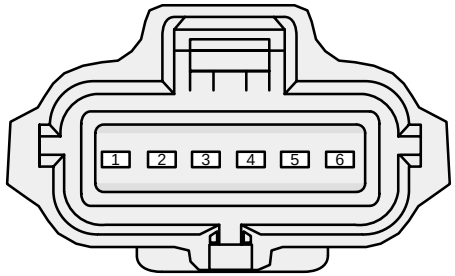

C1041

MASS AIR FLOW (MAF) SENSOR

PIN	CIRCUIT	CIRCUIT FUNCTION
1	359 (GY/RD)	Sensor Signal Return
2	361 (RD)	Power (Hot in Start And Run)
3	570 (BK/WH)	Power Ground
4	968 (TN/LB)	MAF Sensor Signal Return
5	967 (LB/RD)	MAF Signal Output
6	743 (GN)	Intake Air Temperature (IAT) Sensor

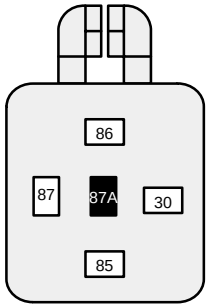

PCM POWER RELAY

PIN	CIRCUIT	CIRCUIT FUNCTION
30	554 (YE/BK)	Power (Hot at All Times)
85	20 (WH/LB)	Power (Hot in Start or Run)
86	57 (BK)	Ground
87	1140 (VT)	Feed for Non-Critical Functions (Hot in Start or Run)
87A	–	NOT USED

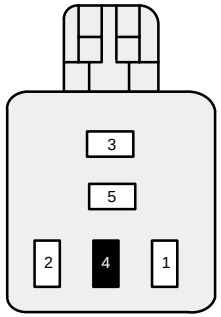

FUEL PUMP RELAY

PIN	CIRCUIT	CIRCUIT FUNCTION
1	361 (RD)	Power (Hot in Start or Run)
2	926 (LB/OG)	Coil Ground (PCM Controlled)
3	1059 (LB/OG)	Power (Hot at All Times)
4	–	NOT USED
5	238 (DG/YE)	Output

CONNECTOR REFERENCE LIST

CONNECTOR	SECTION-PAGE
C250b	60-7
C250c	60-7
C1012	30-4
C1048	30-4