Power window switch, RH side rear

Terminals

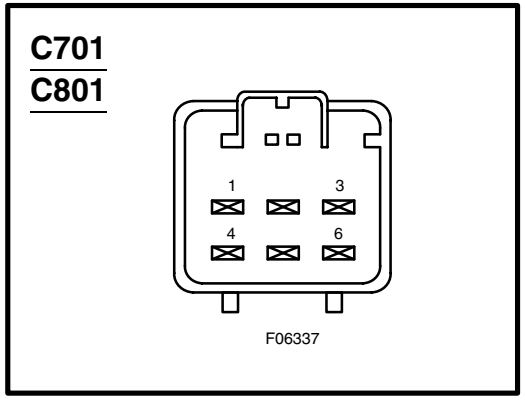

Schematic

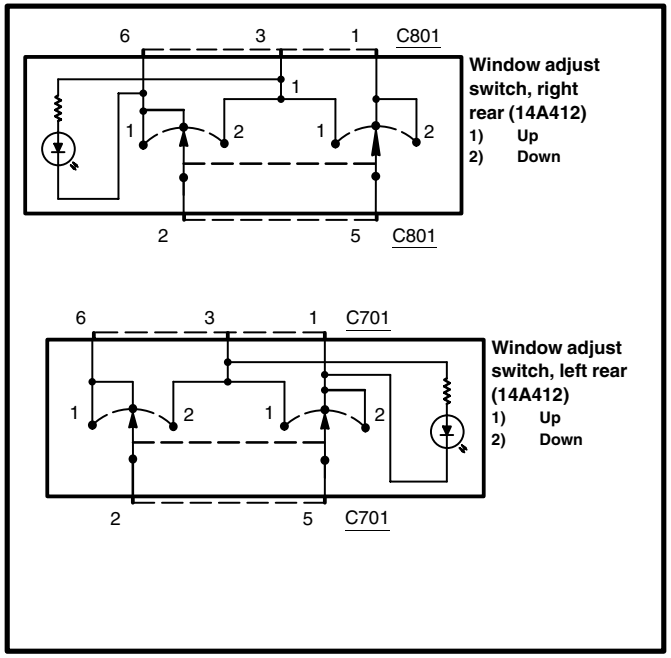

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Up Switch Circuit, Left	3 and 5 – C701	Up	Closed circuit
	6 and 2 – C701 1 and 5 – C701	Rest	Closed circuit
Up Switch Circuit, Right	3 and 5 – C801	Up	Closed circuit
	6 and 5 – C801 1 and 2 – C801	Rest	Closed circuit
Down Switch Circuit, Left	3 and 2 – C701	Down	Closed circuit
	6 and 2 – C701 1 and 5 – C701	Rest	Closed circuit
Down Switch Circuit, Right	3 and 2 – C801	Down	Closed circuit
	6 and 5 – C801 1 and 2 – C801	Rest	Closed circuit