TERMINALS

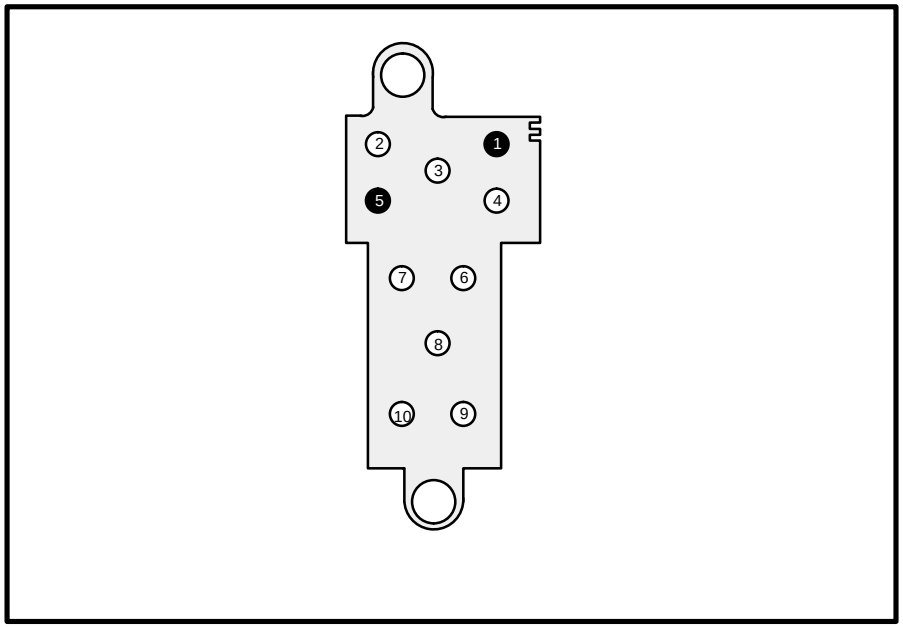

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Power and Ground Checks Before Any Other Tests	8 and 7, 8 and 9	Window Switch (All Positions)	Open Circuit
	7 and 10, 9 and 6	Window Switch (All Rest)	Closed Circuit
Window Circuit	8 and 10, 9 and 6	Up	Closed Circuit
	8 and 6, 10 and 7	Down	Closed Circuit
Door Lock Switch	3 and 4	Lock	Closed Circuit
	3 and 2	Unlock	Closed Circuit
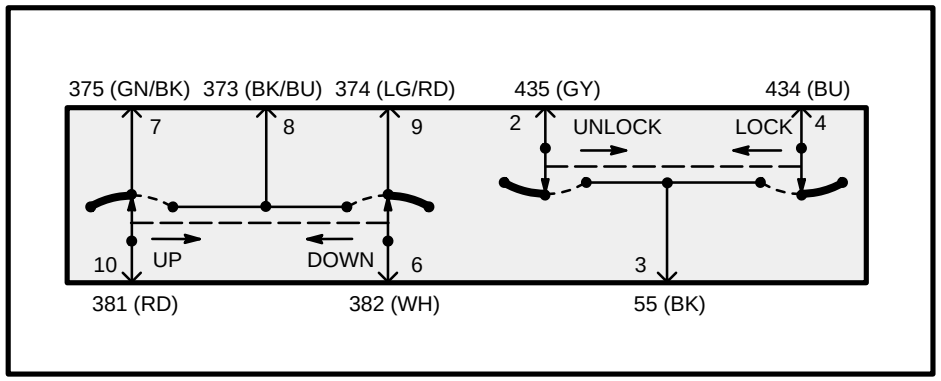
SCHEMATIC