seat height adjust only

Schematic

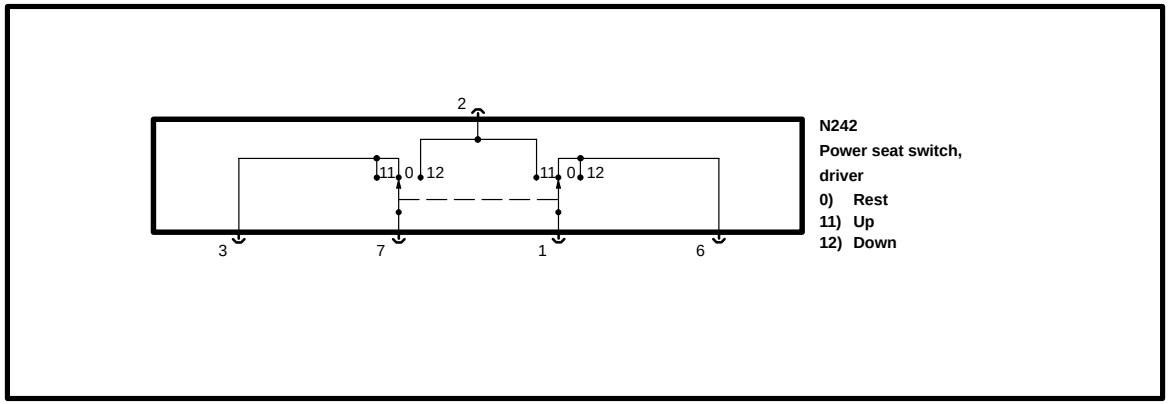

Terminal locations

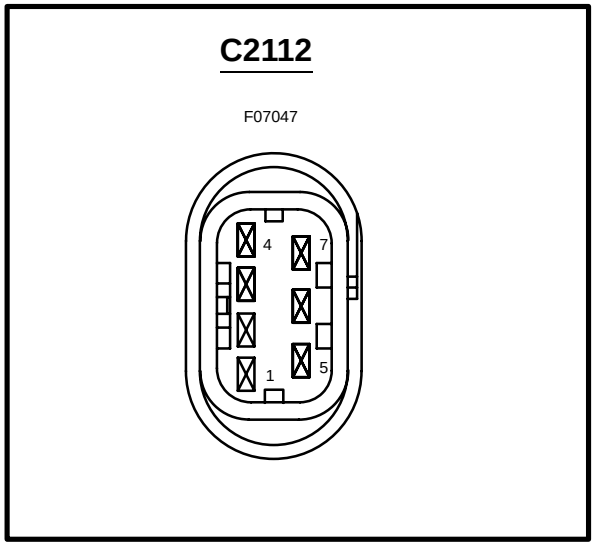

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Height circuit	7 and 2	Rest	Open circuit
		Up	Open circuit
		Down	Closed circuit
	1 and 2	Rest	Open circuit
		Up	Closed circuit
		Down	Open circuit
	7 and 3	Rest	Closed circuit
		Up	Closed circuit
		Down	Open circuit
	1 and 6	Rest	Closed circuit
		Up	Open circuit
		Down	Closed circuit