TERMINALS

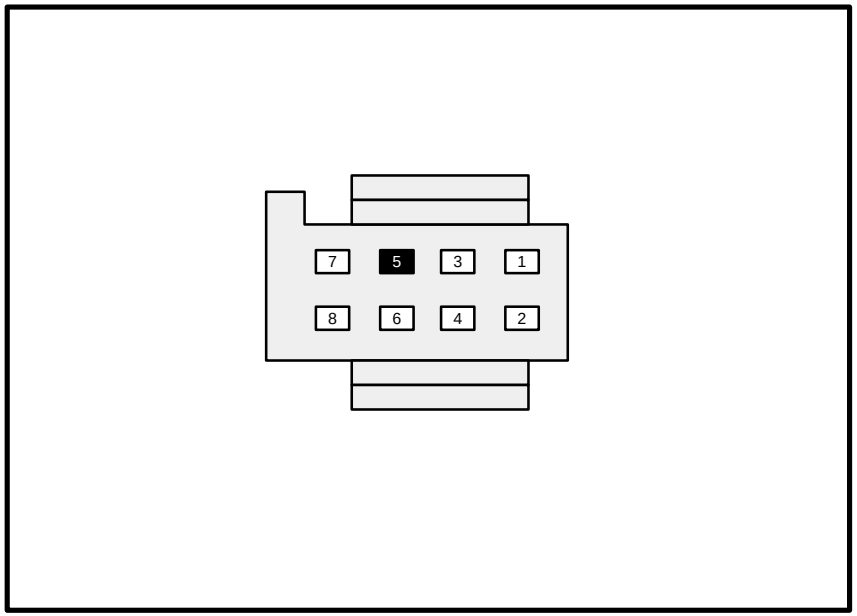

SCHEMATIC

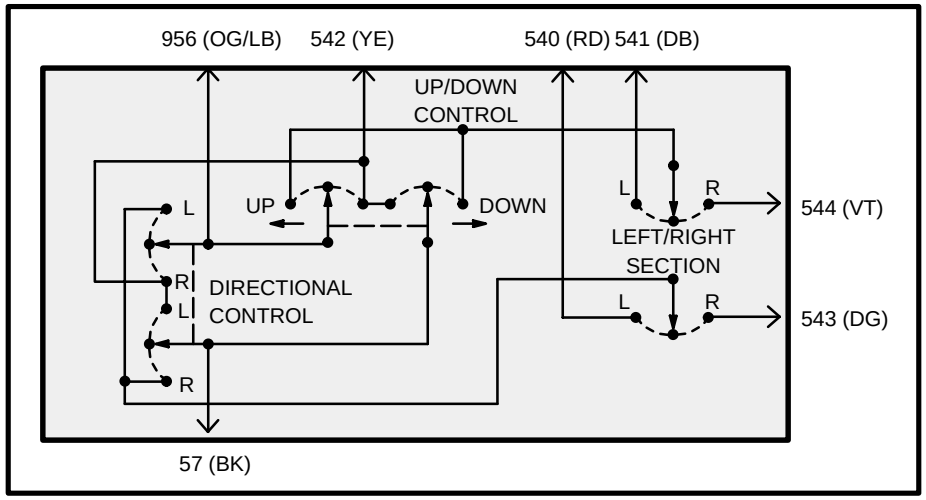

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Left Mirror		Selector Switch Left	
Up	956 and 541 542 and 57	Up	Closed Circuit Closed Circuit
Down	956 and 542 541 and 57	Down	Closed Circuit Closed Circuit
Left	956 and 540 542 and 57	Left	Closed Circuit Closed Circuit
Right	956 and 542 540 and 57	Right	Closed Circuit Closed Circuit
Right Mirror		Selector Switch Right	
Up	956 and 544 542 and 57	Up	Closed Circuit Closed Circuit
Down	956 and 542 544 and 57	Down	Closed Circuit Closed Circuit
Left	956 and 543 542 and 57	Left	Closed Circuit Closed Circuit
Right	956 and 542 543 and 57	Right	Closed Circuit Closed Circuit