Schematic

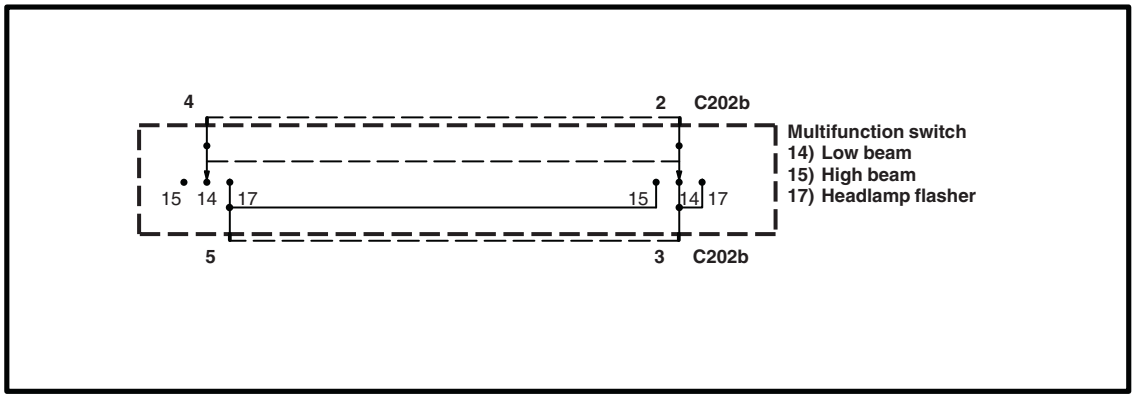

Terminals

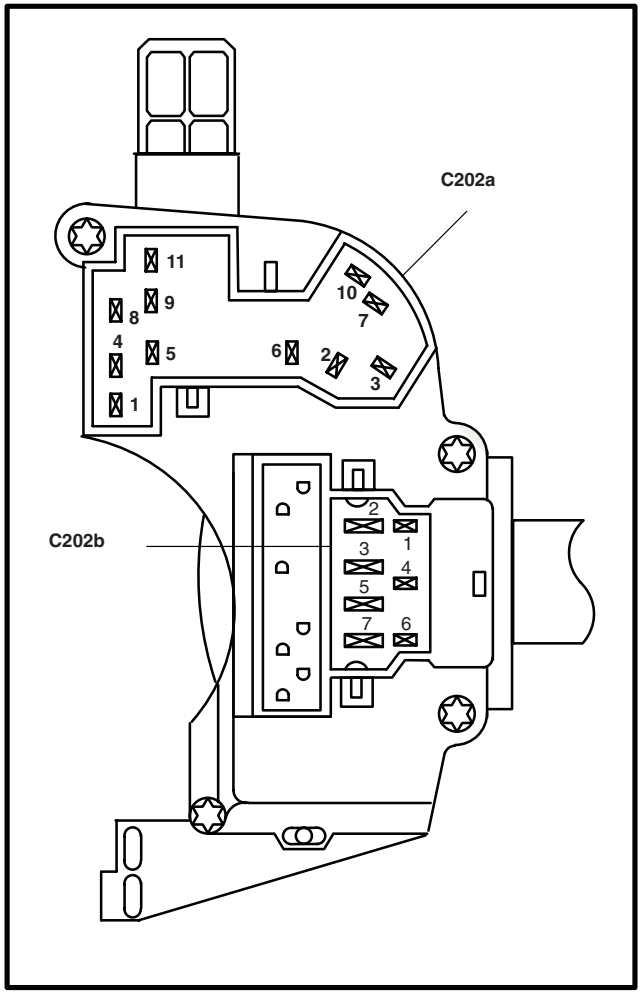

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
High beams	5 and 2	High beam	Closed circuit
		Flash–to–pass	Open circuit
		Low beam	Open circuit
Low beam/ Flash-to–pass	3 and 2	High beam	Open circuit
		Flash–to–pass	Closed circuit
		Low beam	Closed circuit
	5 and 7	High beam	Open circuit
		Flash–to–pass	Closed circuit
		Low beam	Open circuit