COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Recline Circuit	7 and 5	Forward	Closed Circuit
	7 and 4	Rearward	Closed Circuit
Horizontal Movement	7 and 8	Forward	Closed Circuit
	7 and 10	Rearward	Closed Circuit
Rear Tilt Circuit	7 and 1	Down	Closed Circuit
	7 and 2	Up	Closed Circuit
Front Tilt Circuit	7 and 11	Down	Closed Circuit

TERMINALS

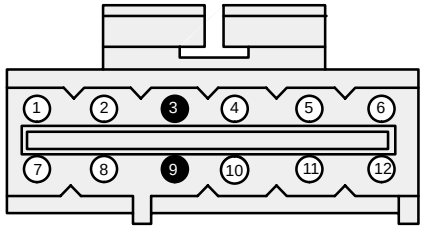

C501
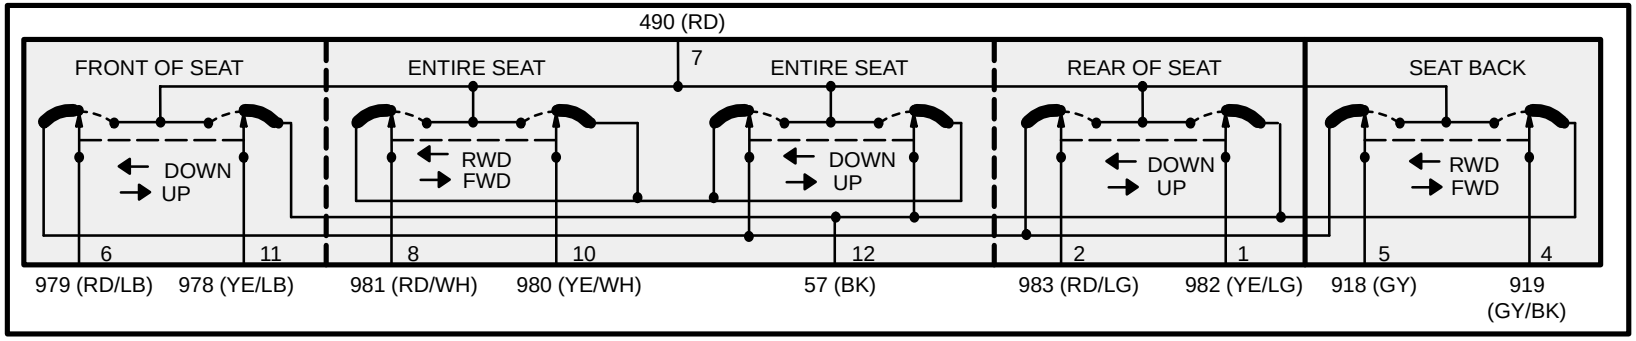
SCHEMATIC