Power window switch, LH side rear

Schematic

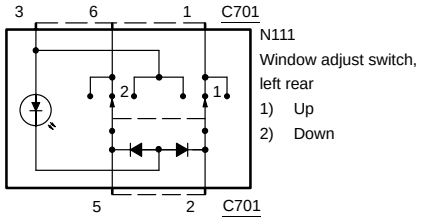

Terminals

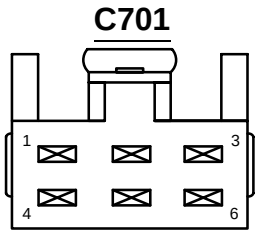

Component testing procedure

Circuit to test	Connect self–powered test light or ohm-meter to terminals	Move switch to these positions	A good switch will indicate
Window adjust switches	3 and 1	Up	Closed circuit
	3 and 5	Down	Closed circuit
	6 and 5 1 and 2	Rest	Closed circuit