TERMINALS

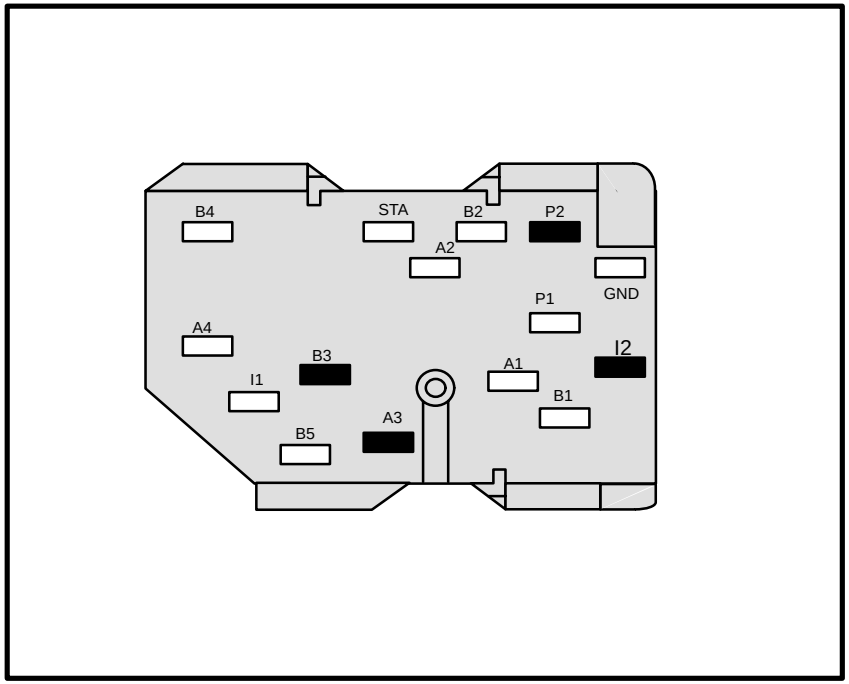

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Starter Relay Circuit	B4 and STA	Acc, Lock, Off, Run, Start	Closed Circuit in Start position only
	B4 and A4	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only
Ignition Circuit	B2 and A2	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only
	B5 and I1	Acc, Lock, Off, Run, Start	Closed Circuit inStart and Run position only
Accessory Circuit	B1 and A1	Acc, Lock, Off, Run, Start	Closed Circuit in Run position only
	B5 and A1	Acc, Lock, Off, Run, Start	Closed Circuit in Acc position only
Bulb – Test Circuit	P1 and GND	Acc, Lock, Off, Run, Start	Closed Circuit in Start position only
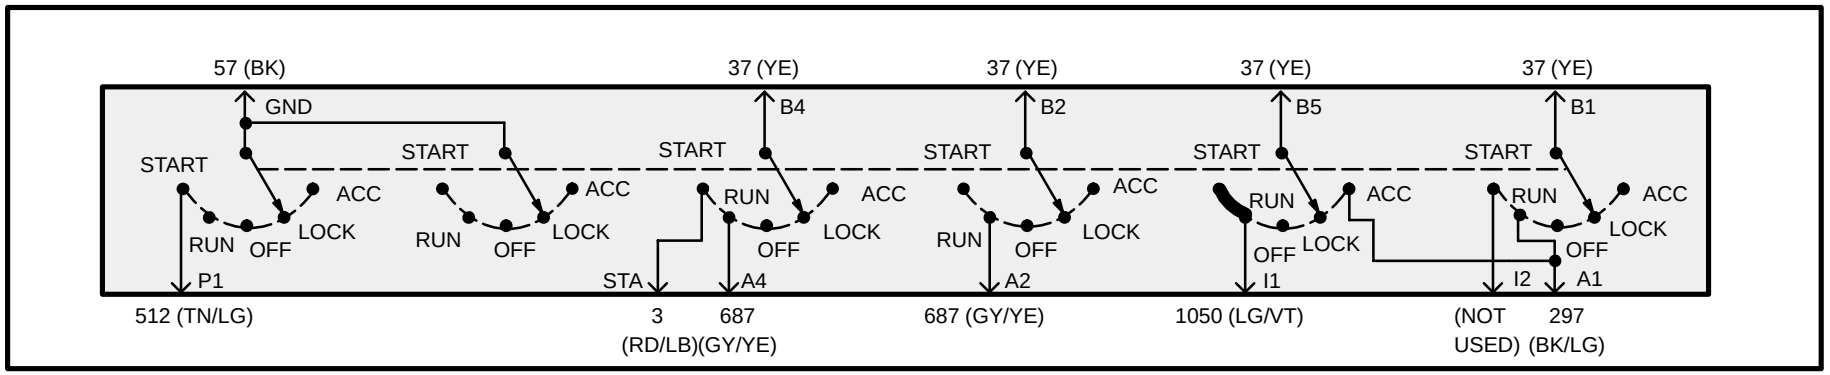
SCHEMATIC