Power seat switch, left

Schematic

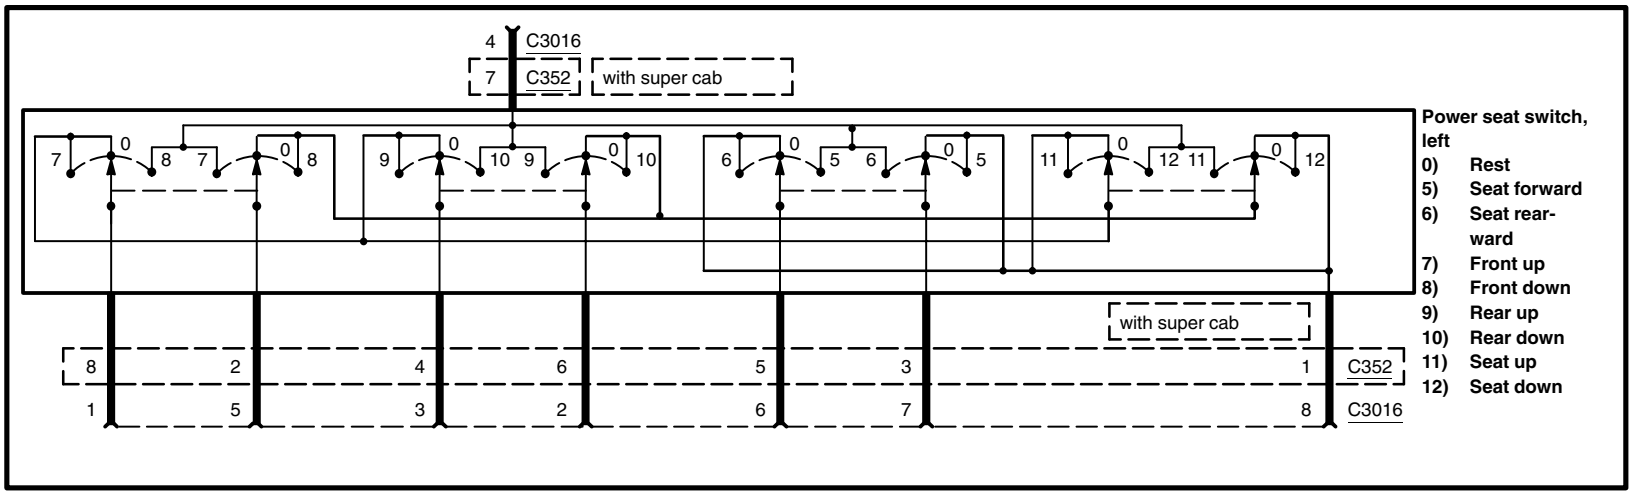

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals		Move switch to these positions	A good switch will indicate
	C352	C3016		
Forward/Rearward circuit	4 and 6 7 and 8	4 and 6 7 and 8	Forward	Closed circuit
			Rearward	Open circuit
	4 and 7 6 and 8	4 and 7 6 and 8	Forward	Open circuit
			Rearward	Closed circuit
Front up/down circuit	4 and 5 1 and 8	4 and 5 1 and 8	Up	Closed circuit
			Down	Open circuit
	4 and 1 5 and 8	4 and 1 5 and 8	Up	Open circuit
			Down	Closed circuit
Rear up/down circuit	4 and 2 3 and 8	4 and 2 3 and 8	Up	Closed circuit
			Down	Open circuit
	4 and 3 2 and 8	4 and 3 2 and 8	Up	Open circuit
			Down	Closed circuit
Up/Down Circuit	4 and 2 4 and 5	7 and 6 7 and 2	Up	Closed circuit
	4 and 3 4 and 1	7 and 4 7 and 8	Down	Closed circuit

Terminals

C352

Super cab

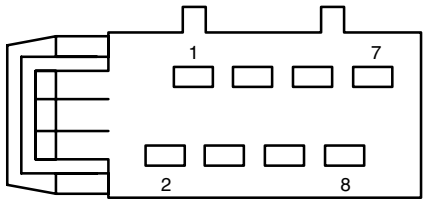

F08112

C3016

all others

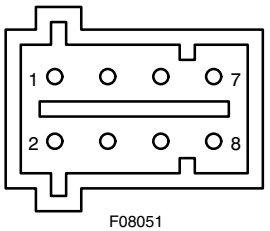

F08051