Multifunction Switch, Lamp Portion

Schematic

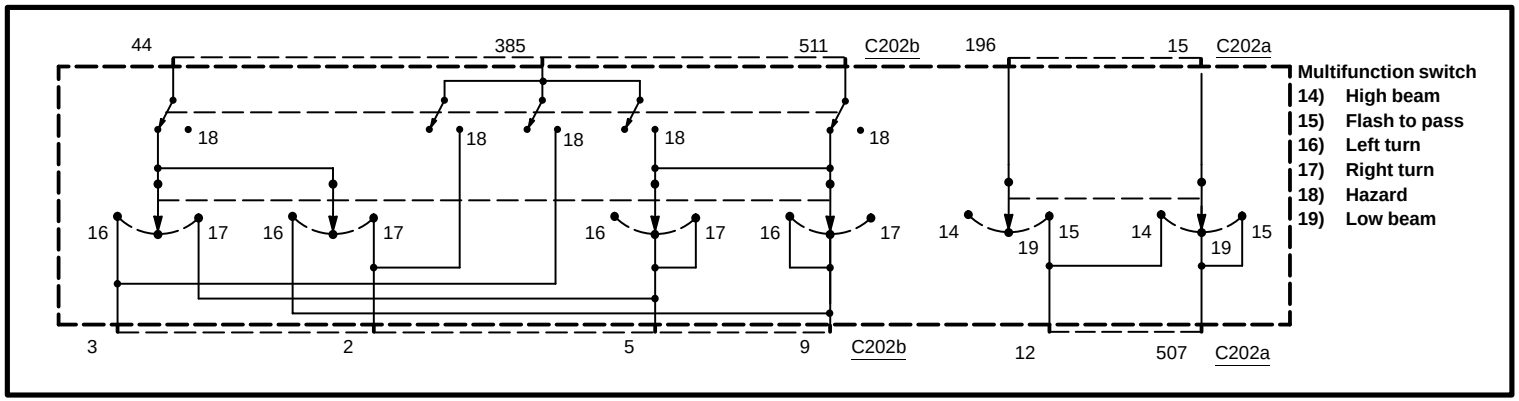

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Turn signal	44 and 9, 3	Hazard switch to Normal (Off) and Turn switch to Left	Closed circuit
	44 and 5, 2	Hazard switch to Normal (Off) and Turn switch to Right	Closed circuit
Hazard	385 and 9, 5, 2, 3	Hazard switch to Hazard (On) (Button pushed in and then released to fully extended position)	Closed circuit
	511 and 9, 5	Hazard switch to Normal (Off) and Turn switch to Neutral	Closed circuit
Flash–to–pass	196 and 12, 15 and 507	Pull and hold lever stalk toward steering wheel	Closed circuit
High beam	15 and 12	Lever stalk in detent away from steering wheel	Closed circuit
Low beam	15 and 507	Lever stalk in detent toward steering wheel	Closed circuit
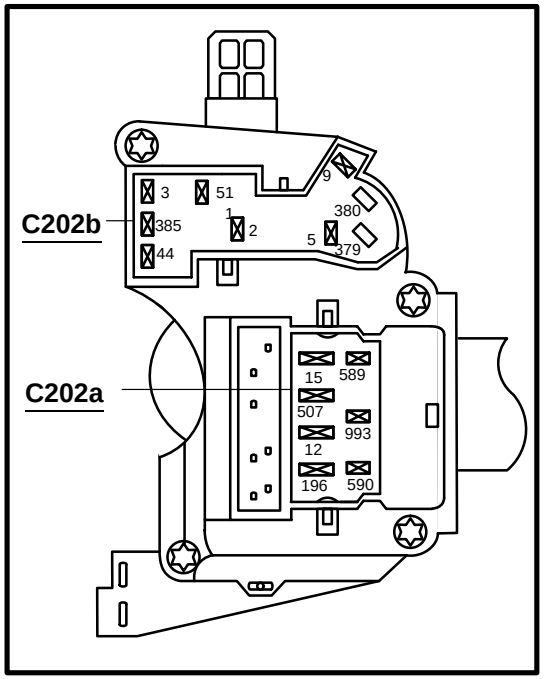
Terminals