Hazard flasher switch

Schematic

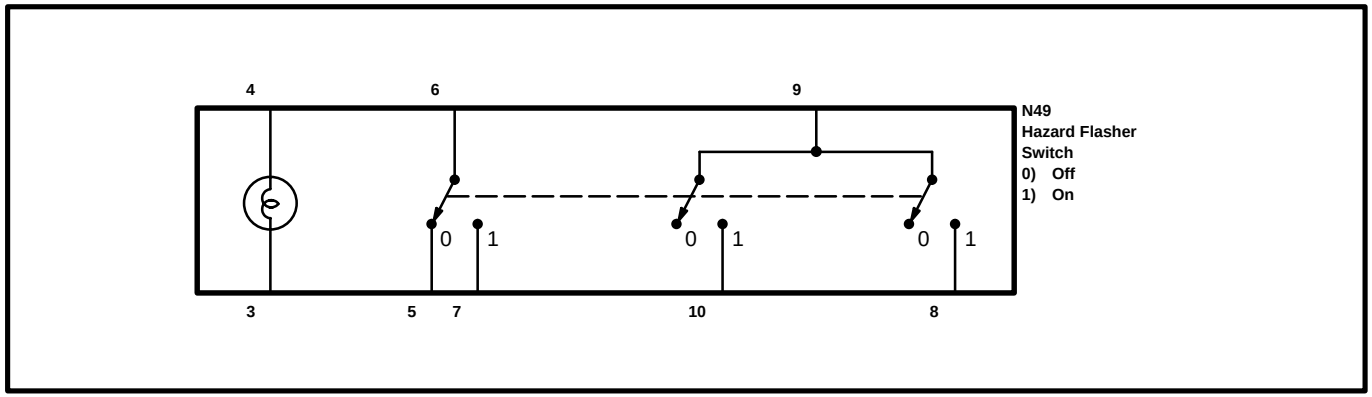

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
RH turn signal	9 and 8	Off	Open circuit
		On	Closed circuit
LH turn signal	9 and 10	Off	Open circuit
		On	Closed circuit
Hazard	6 and 5	Off	Closed circuit
		On	Open circuit
	6 and 7	Off	Open circuit
		On	Closed circuit
Switch illumination	4 and 3	On	Continuity
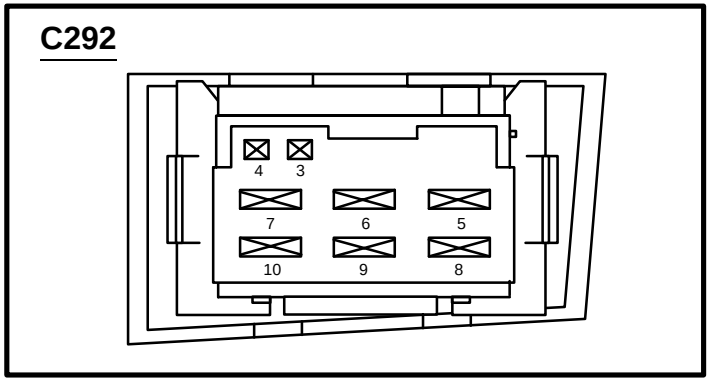
Terminal locations