Multifunction Switch, Wiper/Washer Portion

Schematic

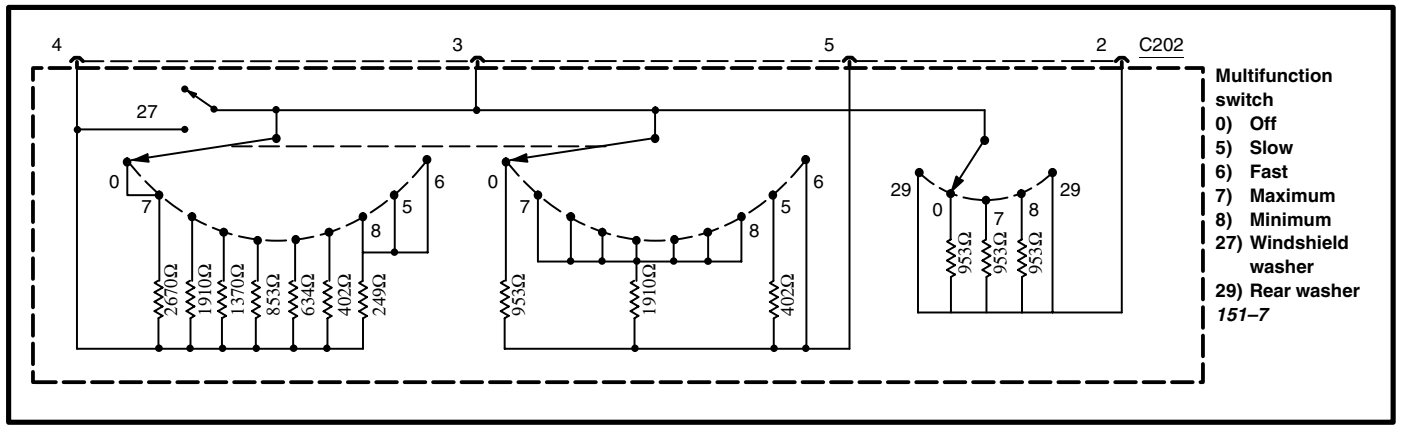

Terminals

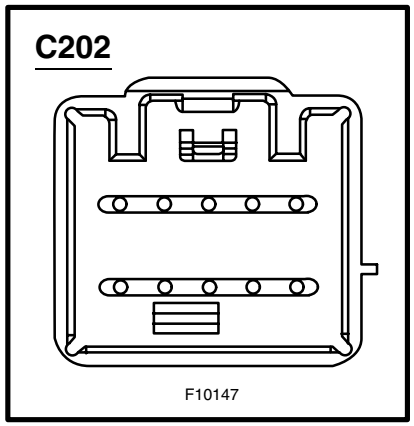

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	3 and 4	Washer switch de-pressed	Closed circuit
		Washer switch normal	103.3KΩ
Wiper switch circuit	3 and 5	Off	47.6KΩ + 5%
		Intermittent	11.33KΩ + 5%
		Low	4.08KΩ + 5%
		High	Closed circuit
Intermittent wiper circuit	3 and 4	Intermittent and Off	Rotate control toward Off; ohmmeter will show smoothly increasing resistance from 3.3kOhm minimum to 103.3kOhm maximum.
		Low and High	3.3 Ω + 10%
Rear wiper switch circuit	3 and 2	Off	2.9KΩ
		Intermittent 1	1KΩ
		Intermittent 2	330Ω
		Washer	Closed circuit