Window adjust switch, right rear (14A412)

Schematic

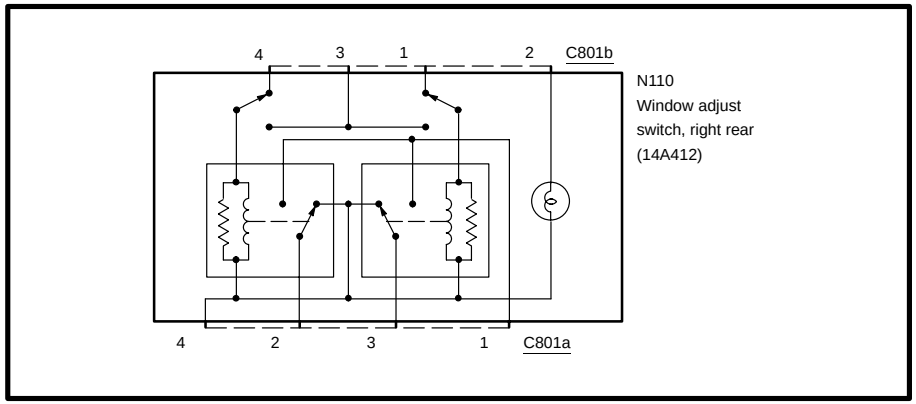

Terminals

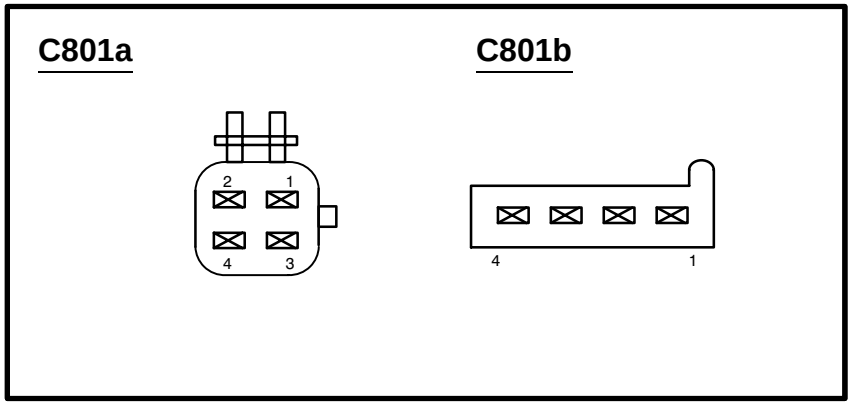

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Connect to power	Connect to ground	Move switch to these positions	A good switch will indicate
Up Switch Circuit	1, C801a 3, C801a	3, C801b	4, C801a	Up	Closed circuit
	1, C801a 3, C801a	1, C801b	4, C801a	Rest	Closed circuit
Down Switch Circuit	1, C801a 2, C801a	3, C801b	4, C801a	Down	Closed circuit
	1, C801a 2, C801a	4, C801b	4, C801a	Rest	Closed circuit