C142 (BU)

7C078/7E443

B88
Heated Oxygen
Sensor (HO2S) #12
(9G444)

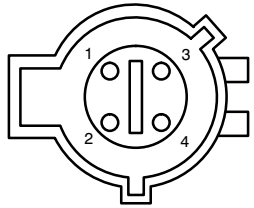

F04082

Pin	Circuit	Circuit function
1	15S-RJ25 (GN/RD)	Voltage, ignition switch in Start or Run (not overload protected), Switched
2	91S-RJ25 (BN/BU)	Ground, Switched
3	9-RJ25 (BN/BU)	Sensor signal return (reference/ground)
4	8-RJ25 (WH/BU)	Sensor signal

C143

7C078

B44a
Turbine shaft speed
sensor (7H103)

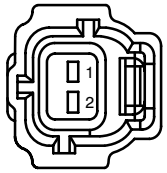

F02066

Pin	Circuit	Circuit function
1	8-TA27 (WH/VT)	Sensor signal
2	9-TA27 (BN/WH)	Sensor signal return (reference/ground)

C144

14A005

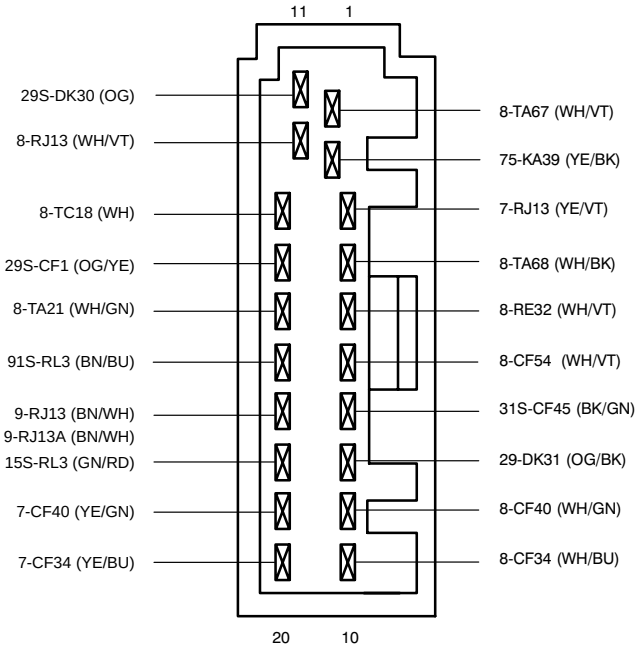

F20041

14290

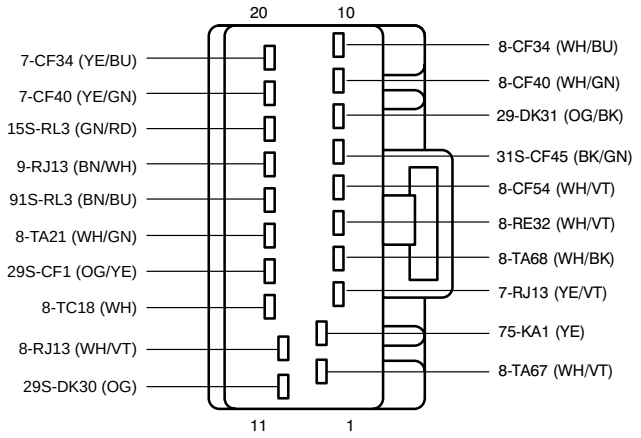

F20017