TERMINALS

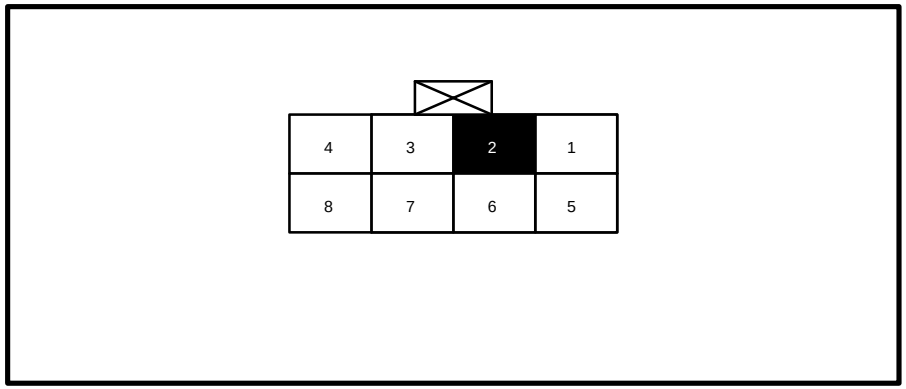

SCHEMATIC

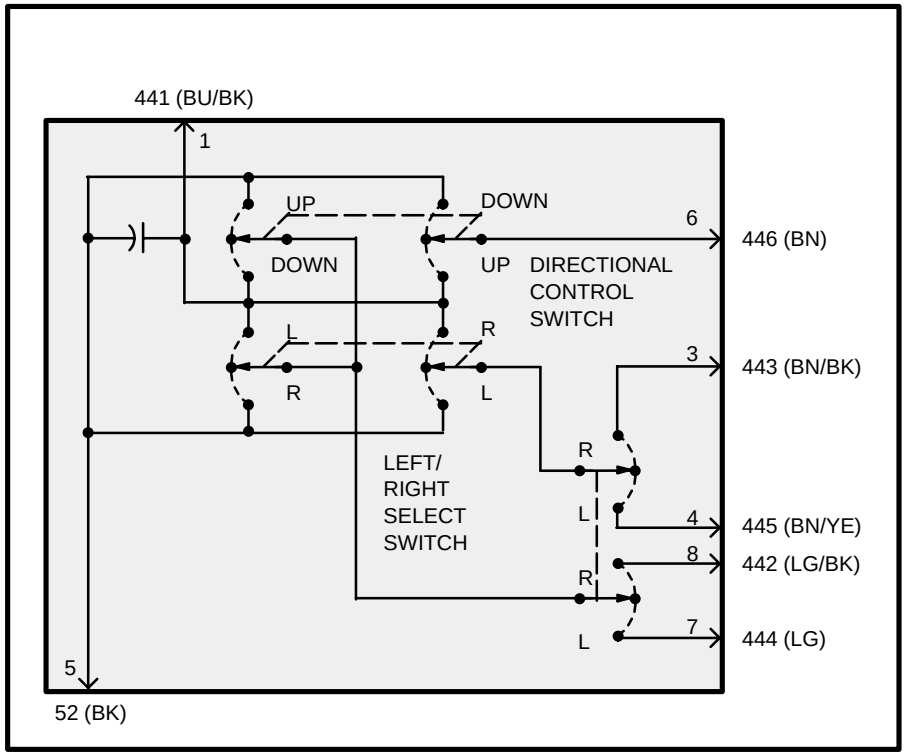

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Left Mirror Up Circuit	1 and 6 7 and 5	Select Switch to Left and Control Switch to Up	Closed Circuit Closed Circuit
Left Mirror Down Circuit	1 and 7 6 and 5	Select Switch to Left and Control Switch to Down	Closed Circuit Closed Circuit
Left Mirror Left Circuit	1 and 7 4 and 5	Select Switch to Left and Control Switch to Left	Closed Circuit Closed Circuit
Left Mirror Right Circuit	1 and 4 7 and 5	Select Switch to Left and Control Switch to Right	Closed Circuit Closed Circuit
Right Mirror Up Circuit	1 and 6 8 and 5	Select Switch to Right and Control Switch to Up	Closed Circuit Closed Circuit
Right Mirror Down Circuit	1 and 8 6 and 5	Select Switch to Right and Control Switch to Down	Closed Circuit Closed Circuit
Right Mirror Left Circuit	1 and 8 3 and 5	Select Switch to Right and Control Switch to Left	Closed Circuit Closed Circuit
Right Mirror Right Circuit	1 and 3 8 and 5	Select Switch to Right and Control Switch to Right	Closed Circuit Closed Circuit