Multifunction Switch, Telescoping Steering Column Control Section

Schematic

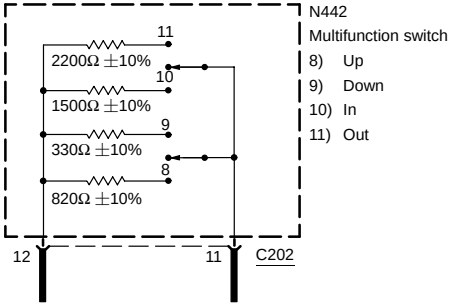

Terminals

C202



F12125

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Up/Down Circuit	11 and 12	Up	820Ω
		Down	330Ω
In/Out Circuit	11 and 12	In	1500Ω
		Out	2200Ω