Component Testing – Headlamp switch, Exterior lamps

SCHEMATIC

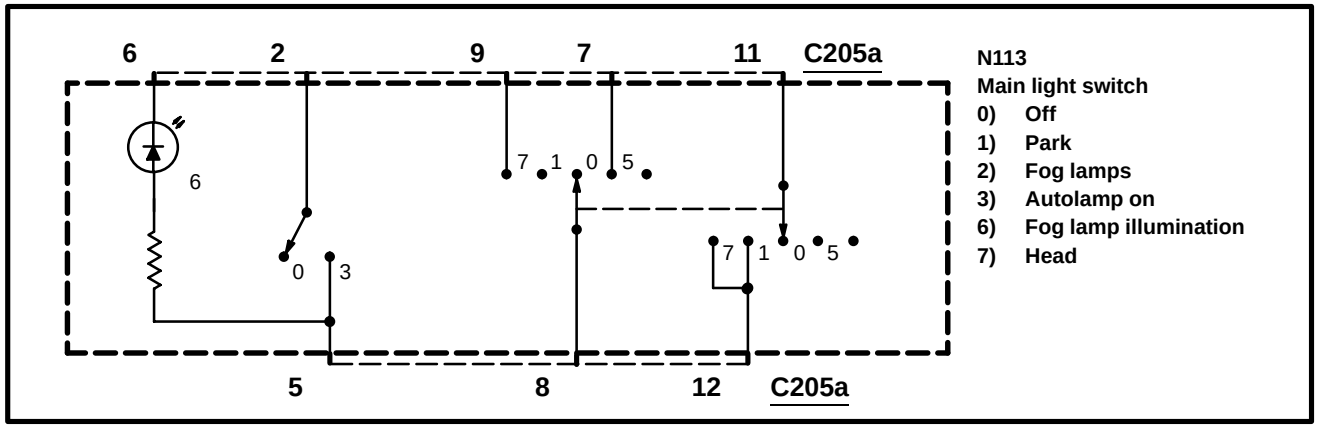

N113
Main light switch
0) Off
1) Park
2) Fog lamps
3) Autolamp on
6) Fog lamp illumination
7) Head

TERMINAL LOCATIONS

C205a

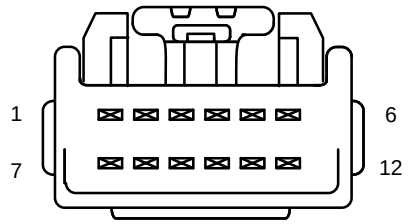

F12101

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Headlamp	9 and 8	Off	Open Circuit
		Head	Closed Circuit
		Park	Open Circuit
		Autolamp On	Open Circuit
Park Lamp	11 and 12	Off	Open Circuit
		Head	Closed Circuit
		Park	Closed Circuit
		Autolamp On	Open Circuit
Autolamp Circuit	7 and 8	Off	Open Circuit
		Head	Open Circuit
		Park	Open Circuit
		Autolamp On	Closed Circuit
Fog Lamps	2 and 5	On	Closed Circuit
		Off	Open Circuit