C142

7C078

Heated Oxygen Sensor (HO2S) #12 (9G444)

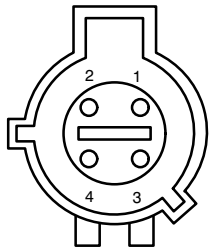

F04082

Pin	Circuit	Circuit function
1	15S-RJ25 (GN/RD)	Voltage supplied in Start and Run (overload protected)
2	91S-RJ25 (BN/BU)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	9-RJ25 (BN/BU)	Signal return
4	8-RJ25 (WH/BU)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C143

7C078

Turbine shaft speed sensor (7H103)

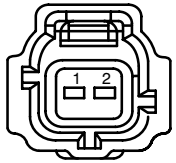

F02101

Pin	Circuit	Circuit function
1	8-TA27 (WH/VT)	Turbine shaft speed sensor (7M101), signal
2	9-TA27 (BN/WH)	Signal return

C144

14A005

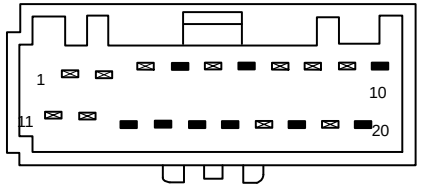

F20047

14290

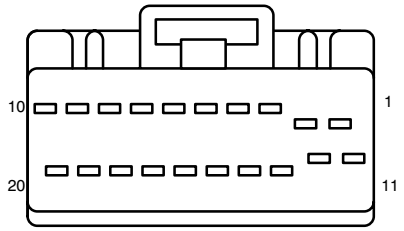

F20017

(1) 8-TA67 (WH/VT)
(2) 75-KA8 (YE/RD)
(3) 7-RJ13 (YE/VT)
(4) 8-TA68 (WH/BK)
(5) 8-RE32 (WH/VT)
(6) 8-CF54 (WH/VT)
(7) 31S-CF45 (BK/GN)
(8) 29-DK31 (OG/BK)
(9) 8-CF40 (WH/GN)
(10) 8-CF34 (WH/BU)
(11) 29S-DK30 (OG)
(12) 8-RJ13 (WH/VT)
(13) 8-KA41 (WH/GN)
(14) 29S-CF1 (OG/YE)
(15) 8-TA21 (WH/GN)
(16) 91S-RL13 (BK/OG)
(17) 9-RJ13A (BN/WH)
(18) 15S-RL3 (GN/RD)
(19) 7-CF40 (YE/GN)
(20) 7-CF34 (YE/BU)