Power seat switch -18

Schematic

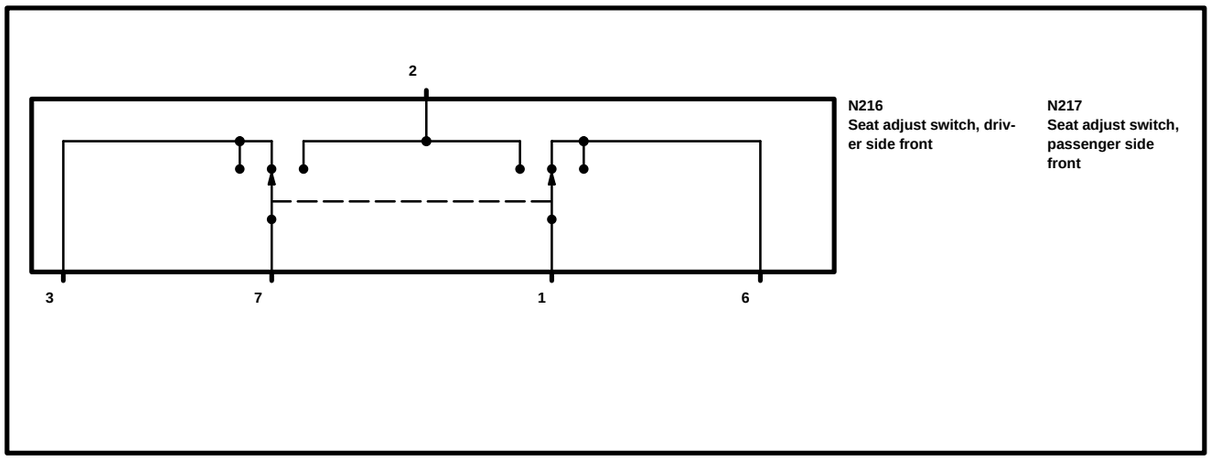

Terminal locations

C715/N216

C715/N217

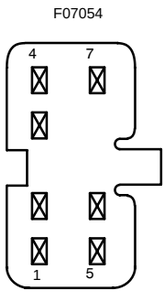

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Height circuit	2 and 7	Rest	Open circuit
		Up	Open circuit
		Down	Closed circuit
	3 and 7	Rest	Closed circuit
		Up	Closed circuit
		Down	Open circuit
	2 and 1	Rest	Open circuit
		Up	Closed circuit
		Down	Open circuit
	6 and 1	Rest	Closed circuit
		Up	Open circuit
		Down	Closed circuit