Relay

Schematic

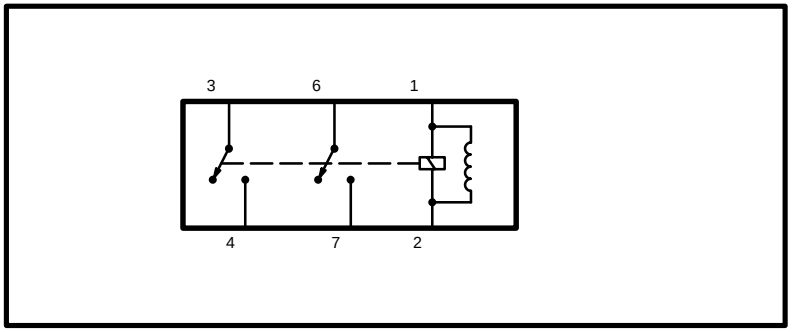

Terminal locations

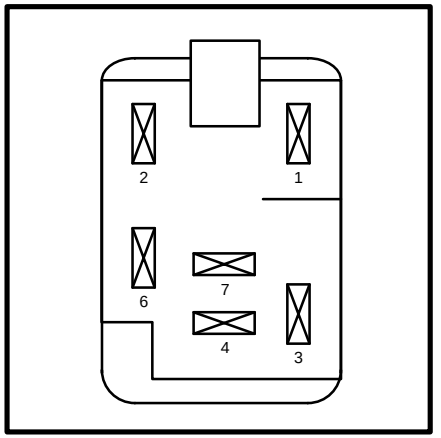

Component testing procedure, no voltage applied

Circuit to test	Connect ohmmeter to terminals	A good relay will indicate
Coil	1 and 2	100–150Ω
Contact	6 and 7	Open circuit
	3 and 4	Open circuit
Coil, Contact	2 and 6	Open circuit
	2 and 3	Open circuit
	2 and 7	Open circuit
	2 and 4	Open circuit

Component testing procedure, voltage applied

Disconnect the ohmmeter; connect pins 1, 6 and 3 to 12V DC power and pin 2 to ground. Measure voltage between pin 7 and pin 2. If the voltage is 12V, continue with the test. If not, replace the relay. Measure voltage between pins 2 and 4. If the voltage is 12V, the relay is okay. If not, replace the relay.