COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Recline Circuit	6 and 5	Forward	Closed Circuit
	6 and 11	Rearward	Closed Circuit
Horizontal Movement	6 and 1	Forward	Closed Circuit
	6 and 7	Rearward	Closed Circuit
Rear Tilt Circuit	6 and 8	Down	Closed Circuit
	6 and 2	Up	Closed Circuit
Front Tilt Circuit	6 and 9	Down	Closed Circuit
Front Tilt Circuit (con't)	6 and 3	Up	Closed Circuit
Check Power and Ground Before Any Other Tests	12 and all others except 6	All four switches at rest	Closed Circuit
	6 and 12	All four switches at rest	Open Circuit

TERMINALS

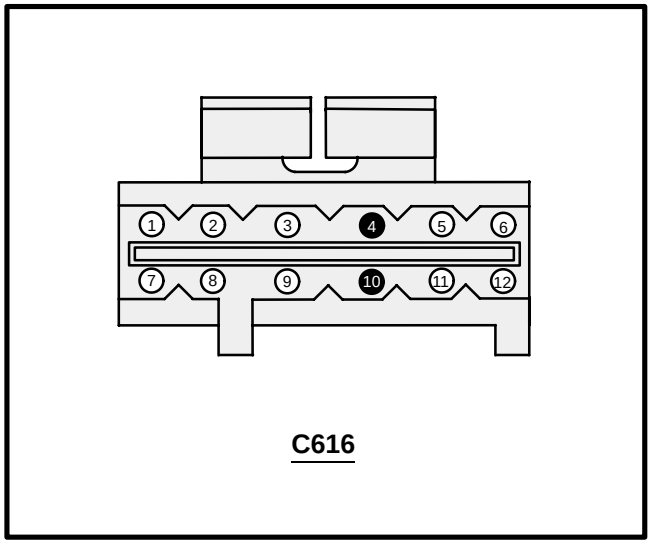

C616
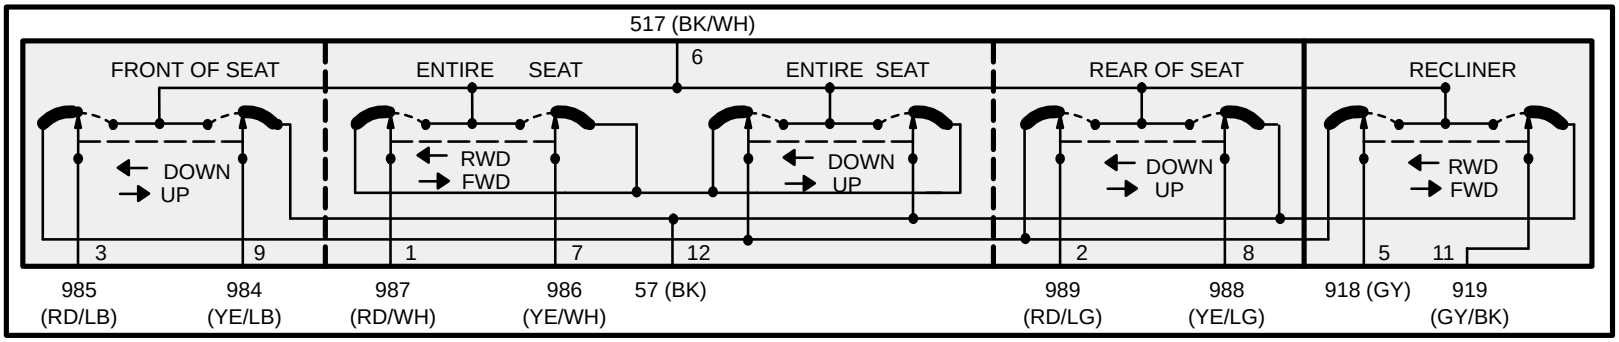
SCHEMATIC