Multifunction Switch, Wiper/Washer Portion

Schematic

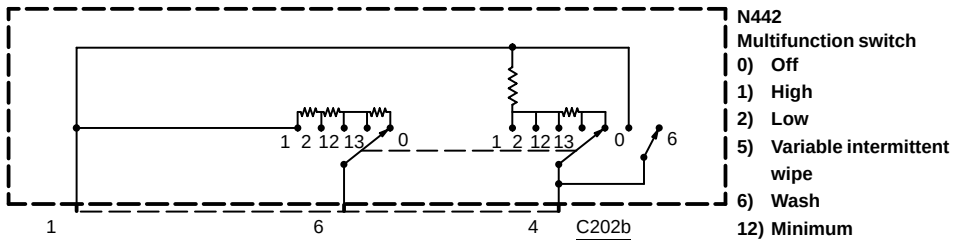

N442
Multifunction switch
0) Off
1) High
2) Low
5) Variable intermittent wipe
6) Wash
12) Minimum
13) Maximum

Terminals

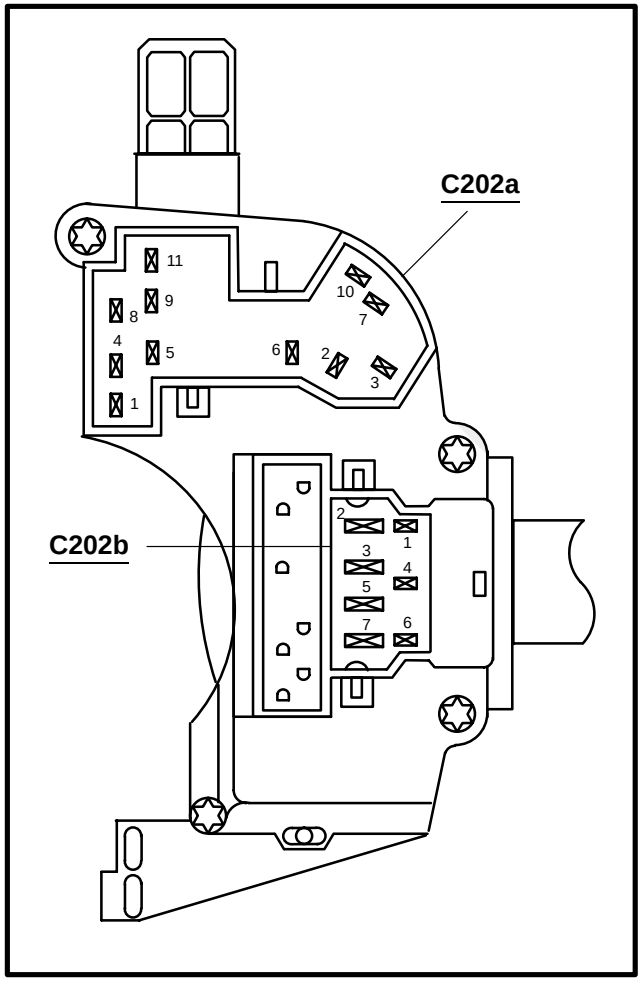

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	6 and 4	Wiper switch Off, Washer switch depressed	Closed circuit
		Wiper switch Off, Washer switch normal	Open circuit
Wiper switch circuit	1 and 4	Off	47.6κ Ω + 15%
		Intermittent	11.33κ Ω + 15%
		Low	4.08κ Ω + 15%
		High	Closed circuit
Intermittent wiper circuit	6 and 4	Intermittent and Off	Rotate control toward Off; ohmmeter will show smoothly increasing resistance from 3.3kOhm minimum to 103.3kOhm maximum.
		Low and High	3.3 Ω + 10%