Component Testing – Hazard flasher switch

SCHEMATIC

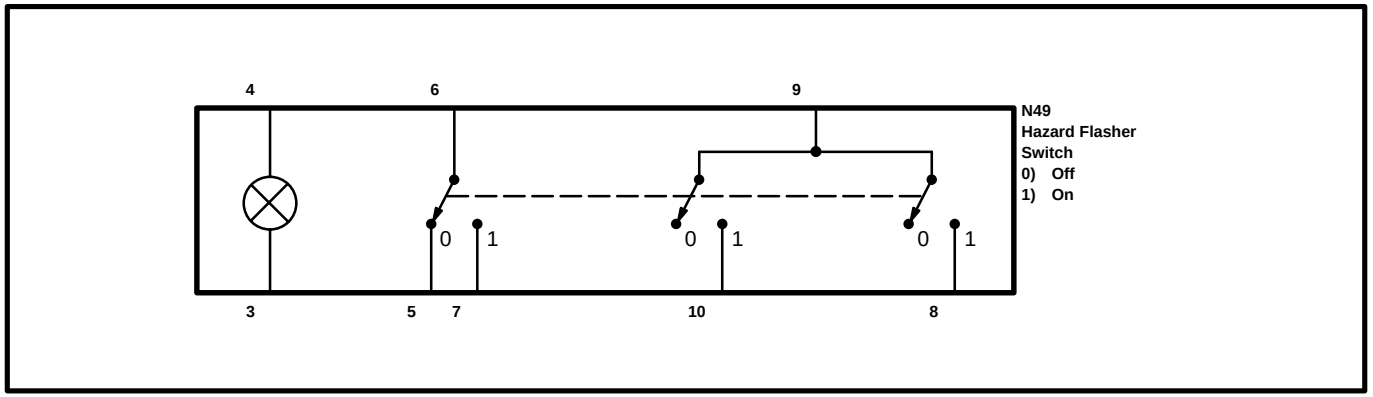

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
RH Turn Signal	9 and 8	Off	Open Circuit
		On	Closed Circuit
LH Turn Signal	9 and 10	Off	Open Circuit
		On	Closed Circuit
Hazard Feed Circuit	6 and 5	Off	Closed Circuit
		On	Open Circuit
	6 and 7	Off	Open Circuit
		On	Closed Circuit
Switch Illumination Bulb Circuit	4 and 3	On	Continuity
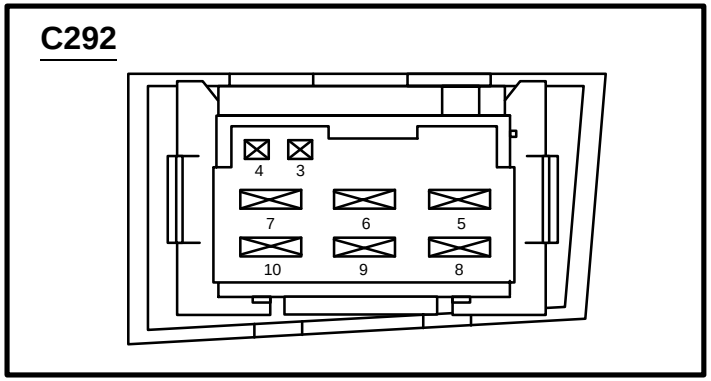
TERMINAL LOCATIONS