Multifunction Switch, Lamp Portion

Schematic

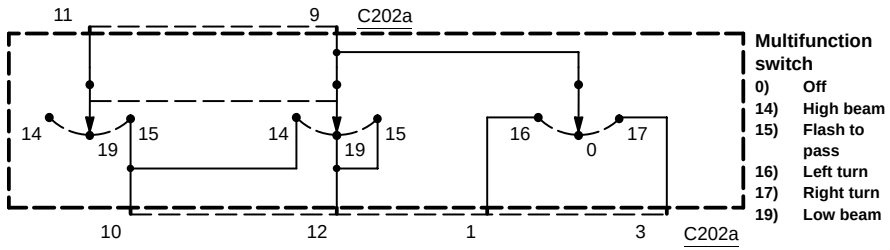

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
High beam	9 and 10	High beam	Closed circuit
		Flash–to–pass	Open circuit
		Low beam	Open circuit
Low beam/Flash–to–pass	9 and 12	High beam	Open circuit
		Flash–to–pass	Closed circuit
		Low beam	Closed circuit
	11 and 10	High beam	Open circuit
		Flash–to–pass	Closed circuit
		Low beam	Open circuit
Cornering lamp	9 and 1	Left turn	Closed circuit
		Off	Open circuit
	9 and 3	Right turn	Closed circuit
		Off	Open circuit

Terminals

C202a

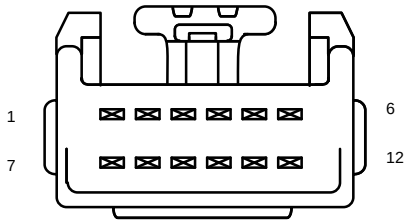

F12075