149-3 COMPONENT TESTING: MULTIFUNCTION SWITCH

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	3 and 4	Washer switch depressed	Closed Circuit
		Washer switch normal	2670 ohm
Wiper Switch Circuit	3 and 5	OFF INT LOW HIGH	953 ohm ± 5% 1910 ohm ± 5% 4.02 ohm ± 5% Closed Circuit
Interval Time Adjust	3 and 4	INT and OFF	Rotate control toward OFF; Ohmmeter will show smoothly increasing resistance from 249 ohm min. to 2670 ohm max.
		LOW and HIGH	249 ohm ±10%
Rear Wiper/ Washer Switch Circuit	3 and 2	OFF INT 1 INT 2 WASH	1910 ohm 953 ohm 402 ohm Closed circuit
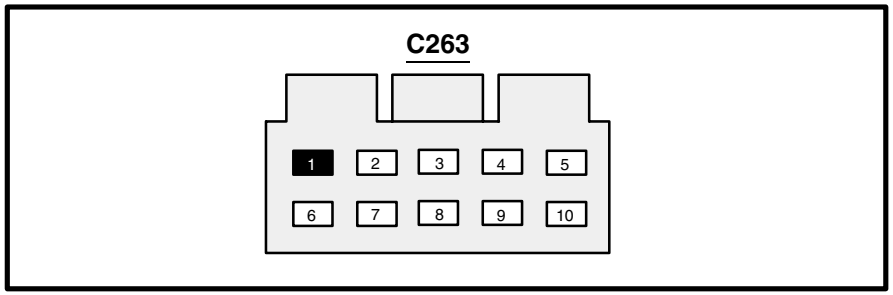
TERMINALS