Component Testing – Headlamp switch

TERMINAL LOCATIONS

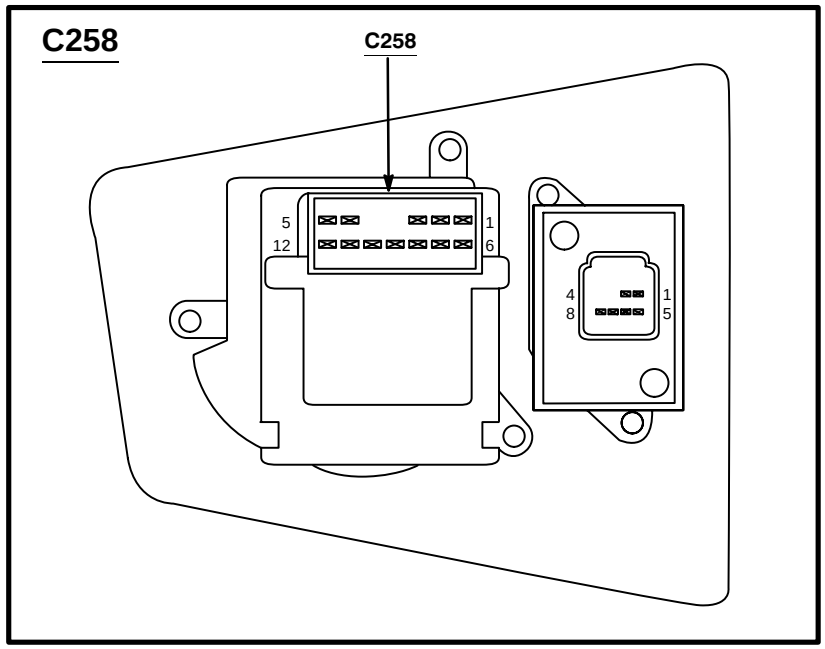

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Headlamp Circuit	3 and 8	Off	Open Circuit
		Park	Open Circuit
		Head	Closed Circuit
Park Lamp Circuit	3 and 7	Off	Open Circuit
		Park	Closed Circuit
		Head	Closed Circuit
Instrument Illumination Circuit	6 and 7	Switch depressed	Closed Circuit
		Switch normal	Open Circuit
Autolamp Feed Circuit	9 and 10	Off	Resistance will increase from Off to Auto 1 to Auto 2
		Auto 1	
		Auto 2	
Switch Illumination Bulb Circuit	2 and 1	Move switch to Park or Head	Continuity
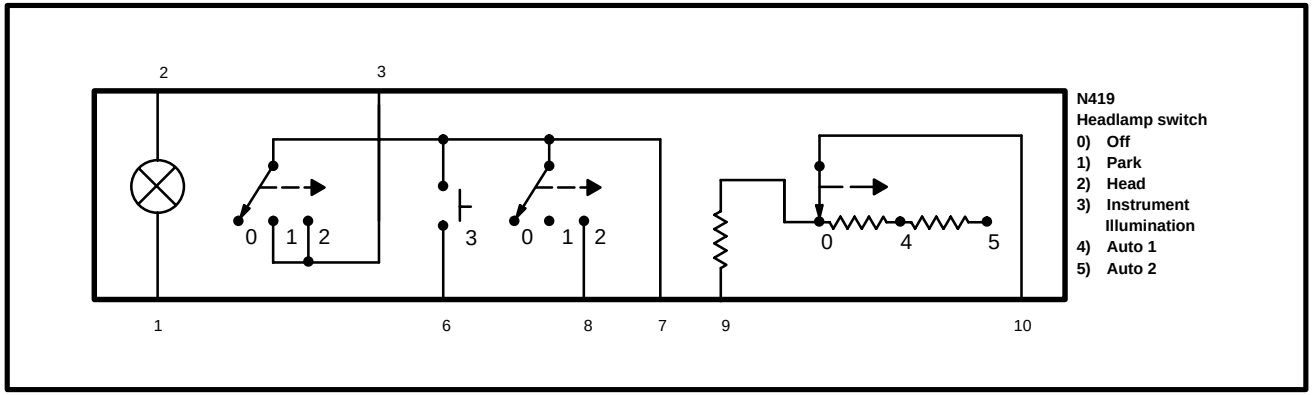
SCHEMATIC