149-7 COMPONENT TESTING: MASTER WINDOW CONTROL SWITCH

TERMINALS

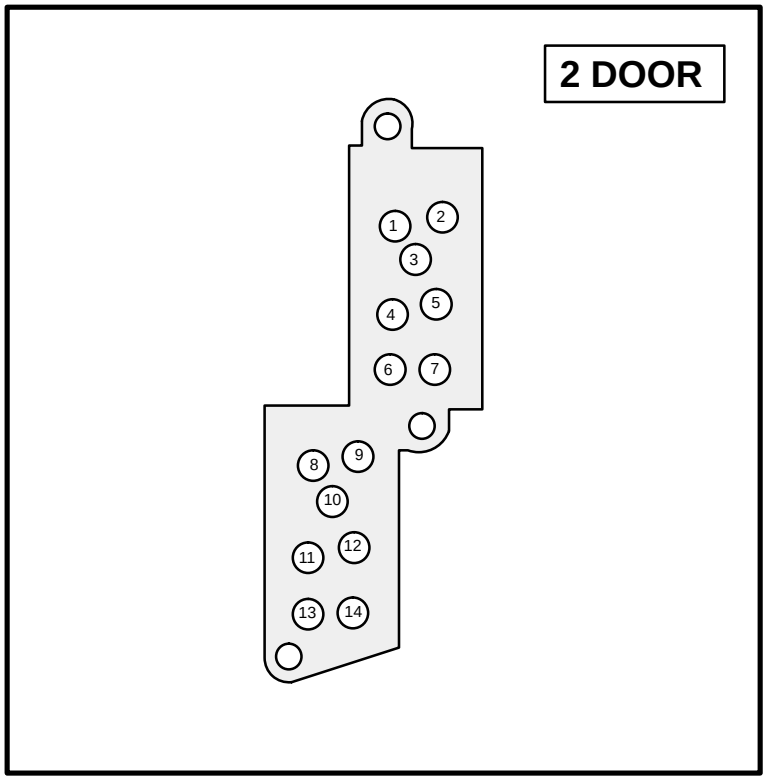

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Left Front Window	3 and 5 3 and 1	Up Down	Closed Circuit Closed Circuit
Right Front Window	10 and 12 10 and 8	Up Down	Closed Circuit Closed Circuit
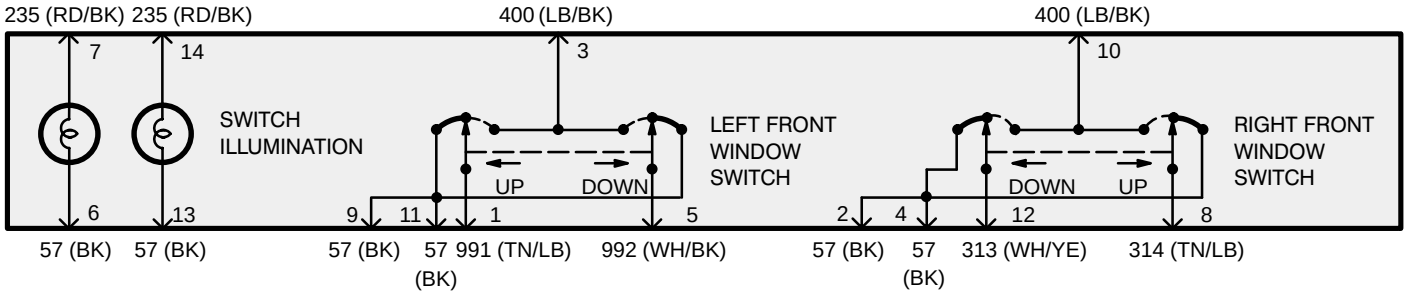
SCHEMATIC