Component Testing – Headlamp switch, Interior lamps

SCHEMATIC

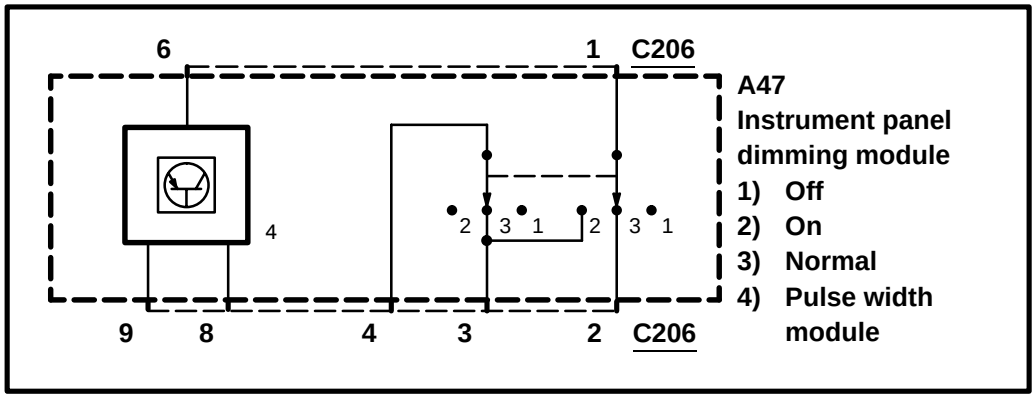

TERMINALS

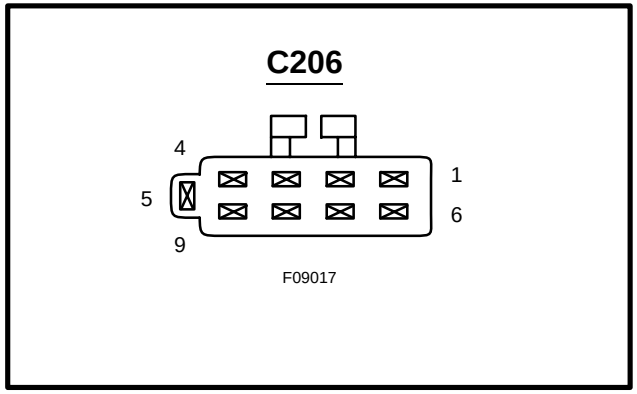

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Interior lamp	1 and 3	On	Closed Circuit
		Off	Open Circuit

COMPONENT TESTING PROCEDURE (voltage applied)

Disconnect the ohmmeter; connect pin 6 using a fused (10A) jumper to 12V DC power and pin 9 to ground. Measure the voltage between pin 8 and pin 9 while rotating the thumbwell from full illumination to no illumination. If the voltage smoothly decreases from near 12 volts to near 0 volts, the illumination dimmer is okay. If not, replace the main light switch.