C197 (GY)

7A488

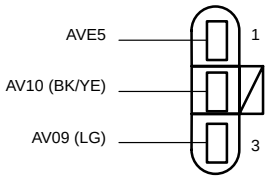

F03125

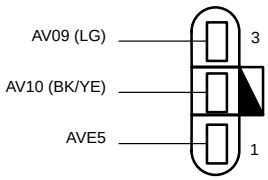

F03127

C200 (WH)

14A103

M111
Windshield wiper
motor

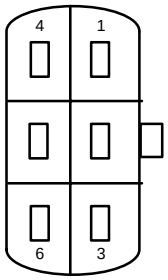

F06153

Pin	Circuit	Circuit Function
1	WA04 (BU/OG)	switched power, output
2	WA05 (BN/WH)	switched power, output
3	–	not used
4	WAE2 (BK)	Ground
5	WA06 (RD)	switched power, input
6	WA01 (BK/WH)	Voltage in Run or Accessory (overload protected)

C198 (GY)

B43
Crankshaft position
sensor

F02137

Pin	Circuit	Circuit Function
1	AV09 (LG)	Crankshaft position sensor
2	AV10 (BK/YE)	signal, return

C202 (BU)

14A103

P91
Central Junction
Box (CJB)



F02171

Pin	Circuit	Circuit Function
1	DA19 (WH/RD)	Voltage supplied at all times (overload protected)
2	DA07 (WH/BU)	Voltage supplied at all times (overload protected)

C199 (GY)

14A103

B212
Heated Oxygen Sensor
(HO2S), rear

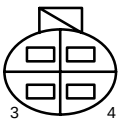

F04159

Pin	Circuit	Circuit Function
1	AW43 (YE)	signal, return
2	AW41 (WH)	Heated Oxygen Sensor (HO2S), rear, input
3	AW42 (BK)	Ground
4	AW40 (BU/YE)	Voltage supplied in Start and Run (overload protected)