C207

IP Harness

Key switch

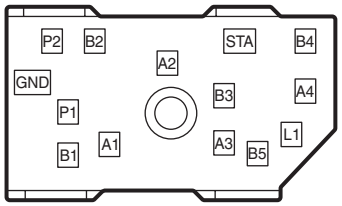

3577218C1

Pin	Circuit	Circuit Function
A1	297 (BK/LG)	Fused run/accessory feed
A2	730 (GY/LB)	Headlamp leveling switch feed
A3	1040 (RD/BK)	Run only feed for non-critical functions
A4	687 (GY/YE)	Accessory feed
B1	37 (YE)	Battery to load
B2	1053 (LB/PK)	Fused batt feed to air suspension compressor motor relay contact
B3	37 (YE)	Battery to load
B4	1050 (LG/VT)	Fused ignition switch feed to run/run start
B5	1050 (LG/VT)	Fused ignition switch feed to run/run start
L1	964 (DB/LG)	Fused accessory #4
L2	—	Not used
P1	—	Not used
P2	—	Not used
STA	32 (RD/LB)	Starter control
GND	—	Not used

C208

IP Harness

Brush assembly

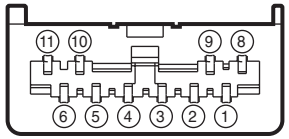

3574241C1

Pin	Circuit	Circuit Function
1	—	Not used
2	57 (BK)	Ground circuit
3	—	Not used
4	—	Not used
5	—	Not used
6	1 (DB)	Horn switch control
7	—	Not used
8	—	Not used
9	—	Not used
10	158 (BK/PK)	Key warning switch

C209

IP Harness

Multi-function switch

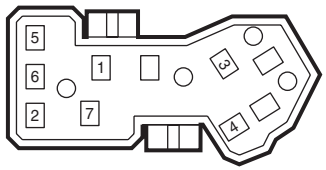

3574234C1

Pin	Circuit	Circuit Function
1	2 (WH/LB)	RH front turn signal lamp
2	3 (LG/WH)	LH front turn signal lamp
3	5 (OG/LB)	RH rear turn signal lamp
4	9 (LG/OG)	LH rear turn signal lamp
5	44 (LB)	Turn signal flasher to turn signal switch
6	385 (WH/RD)	Flasher to emergency warning switch
7	511 (LG)	Stoplamp (brake on/off) switch to stoplamps