Schematic

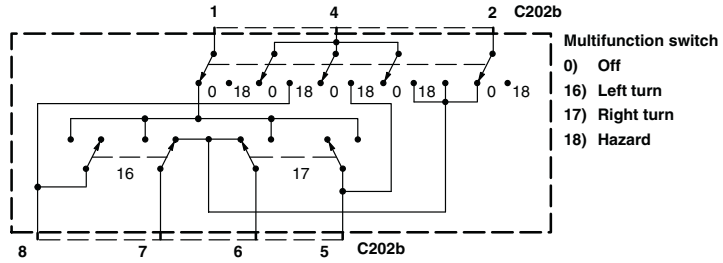

Terminals

C202b

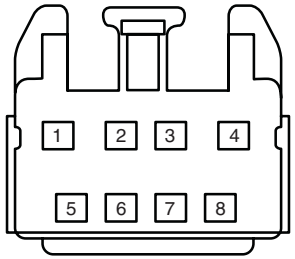

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Turn signal	1 and 7	Left turn	Closed circuit
	1 and 8		
	1 and 5	Right turn	Closed circuit
	1 and 6		
Hazard	4 and 5 4 and 6 4 and 7 4 and 8	Turn signal switch in neutral, Hazard On	Closed circuit
	4 and 5 4 and 6 4 and 7 4 and 8	Turn signal switch in neutral, Hazard Off	Open circuit
	2 and 6 2 and 7	Turn signal switch in neutral, Hazard Off	Closed circuit