Component Testing – Relay

SCHEMATIC

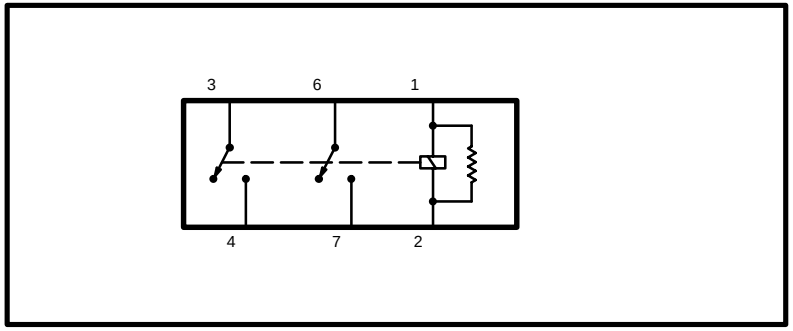

TERMINAL LOCATIONS

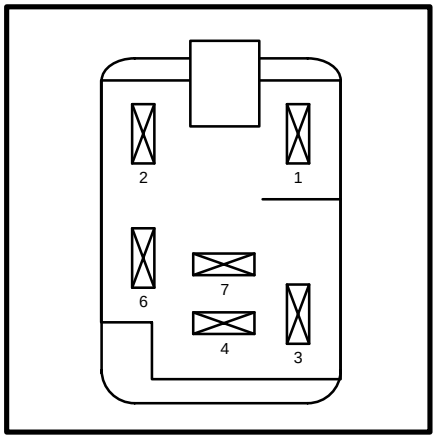

COMPONENT TESTING PROCEDURE (no voltage applied)

TO TEST	Connect Ohmmeter to Terminals	A Good Relay Will Indicate
Coil	1 and 2	100–150 ohms
Contact	6 and 7	Open Circuit
	3 and 4	Open Circuit
Coil–Contact	2 and 6	Open Circuit
	2 and 3	Open Circuit
	2 and 7	Open Circuit
	2 and 4	Open Circuit

COMPONENT TESTING PROCEDURE (voltage applied)

Disconnect the ohmmeter; connect pins 1, 6 and 3 to 12V DC power and pin 2 to ground. Measure voltage between pin 7 and pin 2. If the voltage is 12V, continue with the test. If not, replace the relay. Measure voltage between pins 2 and 4. If the voltage is 12V, the relay is okay. If not, replace the relay.