Lumbar adjust switch, right front

Schematic

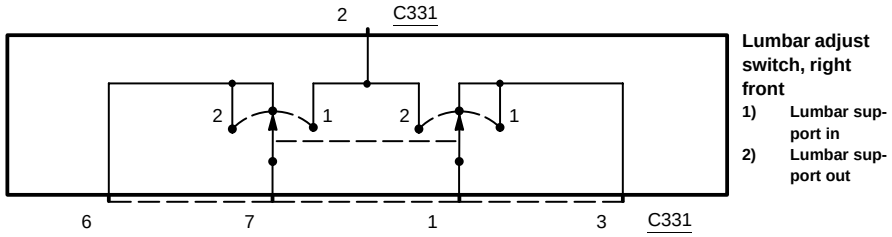

Terminals

C331

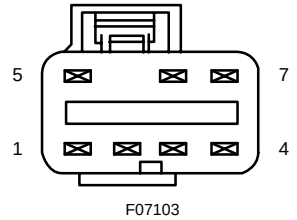

Component testing procedure

Circuit to test	Connect self–powered test light or ohm-meter to terminals	Move switch to these positions	A good switch will indicate
Lumbar circuit	2 and 1	In	Open circuit
		Out	Closed circuit
	2 and 7	In	Closed circuit
		Out	Open circuit
	3 and 1	In	Closed circuit
		Out	Open circuit
	6 and 7	In	Open circuit
		Out	Closed circuit