Multifunction Switch, Wiper/Washer Portion

Schematic

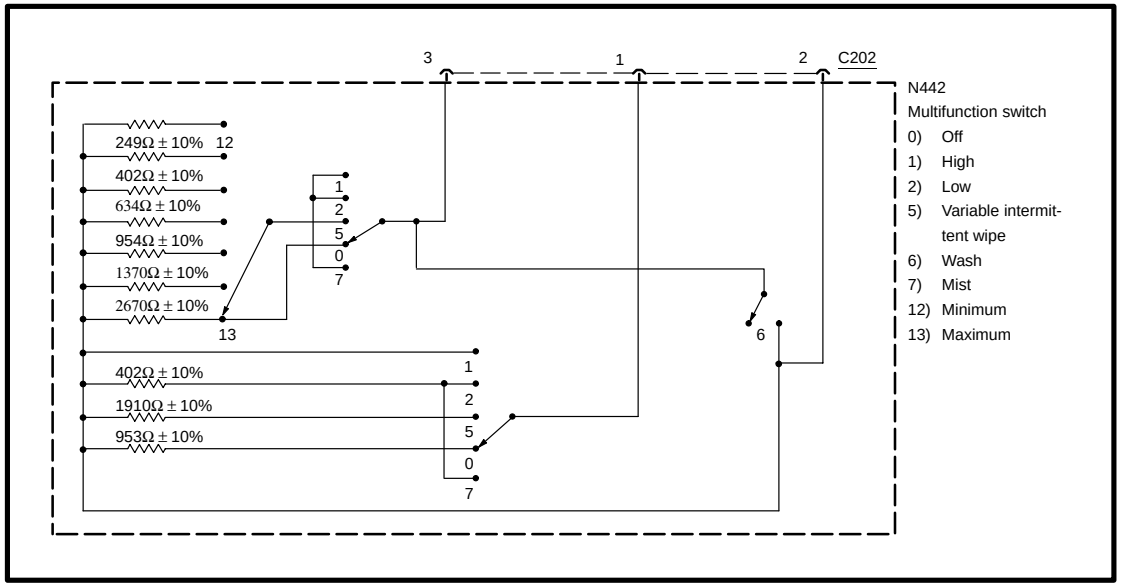

Terminals

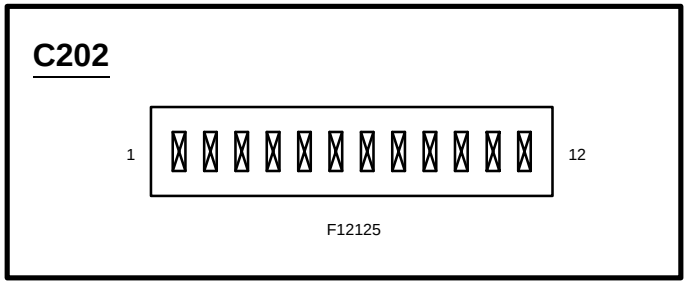

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
Washer switch circuit	2 and 3	Wiper switch Off, Washer switch depressed	Closed circuit
		Wiper switch Off, Washer switch normal	2670Ω
Wiper switch circuit	1 and 2	Off	953Ω
	2 and 3		2670Ω
	1 and 2	High	Closed circuit
	2 and 3		249Ω
	1 and 2	Low	402Ω
	2 and 3		249Ω
	1 and 2	Mist	402Ω
	2 and 3		249Ω
Intermittent wiper circuit	1 and 2	Minimum to Maximum	1910Ω
	2 and 3		249Ω–2670Ω