C143

7C078

B44
Turbine shaft speed sensor (7M101)

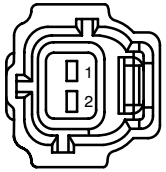

F02066

Pin	Circuit	Circuit Function
1	8-TA27 (WH/VT)	Sensor signal
2	9-TA27 (BN/WH)	Sensor signal return (reference/ground)

C150

14290

B15
Wheel speed sensor, left front (2C205)

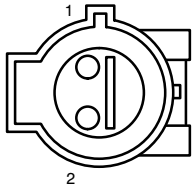

F02085

Pin	Circuit	Circuit Function
1	7-CF32 (YE)	Voltage D.C. supplied at all times (sensor)
2	8-CF32 (WH)	Sensor signal

C151

15A434

E40a
Side lamp, left front (15A201)

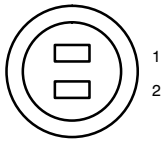

F02086

Pin	Circuit	Circuit Function
1	31S-LF8 (BK/OG)	Ground, switch
2	29S-LF8 (OG)	Voltage supplied at all times (overload protected), switch

C160

14290

B14
Wheel speed sensor, right front (2C204)

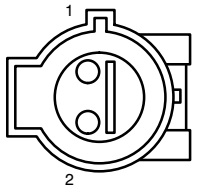

F02085

Pin	Circuit	Circuit Function
1	7-CF38 (YE/RD)	Voltage D.C. supplied at all times (sensor)
2	8-CF38 (WH/RD)	Sensor signal

C161

15A434

E32a
Side lamp, right front (15A201)

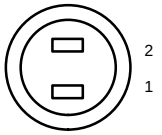

F02063

Pin	Circuit	Circuit Function
1	31S-LF17 (BK/WH)	Ground, switch
2	29S-LF17 (OG/WH)	Voltage supplied at all times (overload protected), switch

C163

18C463

M202
Auxiliary coolant pump motor

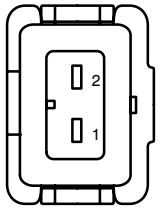

F02089

Pin	Circuit	Circuit Function
1	30S-FB1 (RD/YE)	Voltage supplied at all times (not overload protected), Switched
2	31-FB1 (BK/YE)	Ground