Component Testing – Master window adjust switch

SCHEMATIC

!!! No Data Found !!!

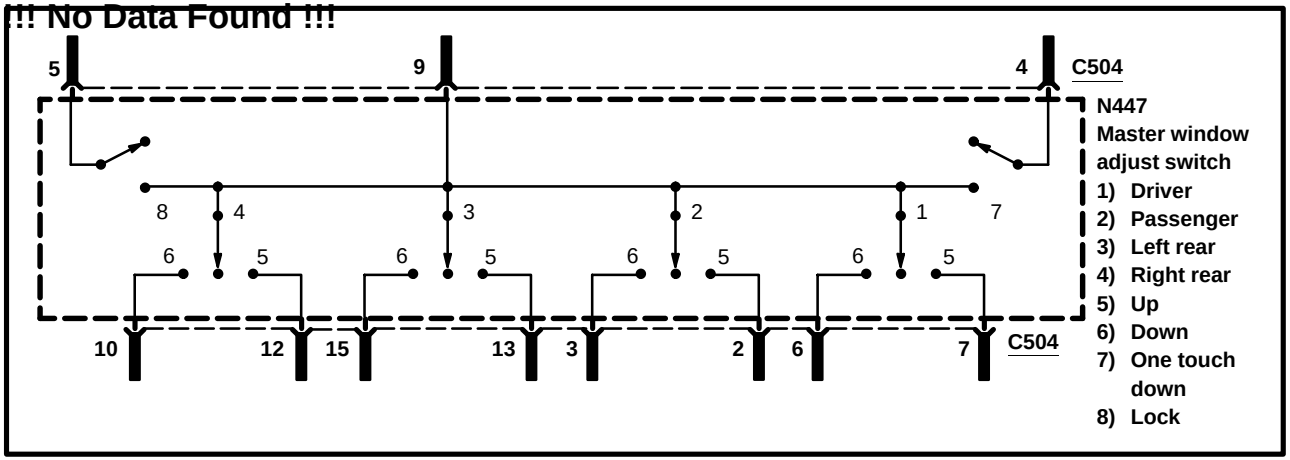

TERMINAL LOCATIONS

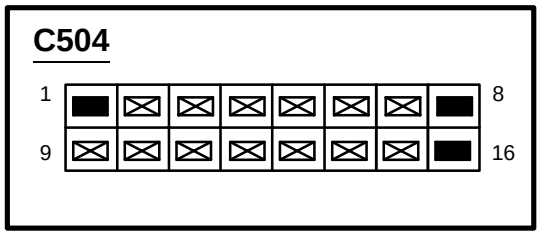

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Switch Lock	5 and 9	Lock On	Closed Circuit
		Lock Off	Open Circuit
One Touch Down Switch	4 and 9	Down	Closed Circuit
		Neutral	Open Circuit
Left Front Window Circuit	7 and 9	Up	Closed Circuit
	6 and 9	Down	Closed Circuit
Right Front Window Circuit	2 and 9	Up	Closed Circuit
	3 and 9	Down	Closed Circuit
Left Rear Window Circuit	9 and 13	Up	Closed Circuit
	9 and 15	Down	Closed Circuit
Right Rear Window Circuit	9 and 12	Up	Closed Circuit
	9 and 10	Down	Closed Circuit