Multifunction Switch, Lamp Portion

Schematic

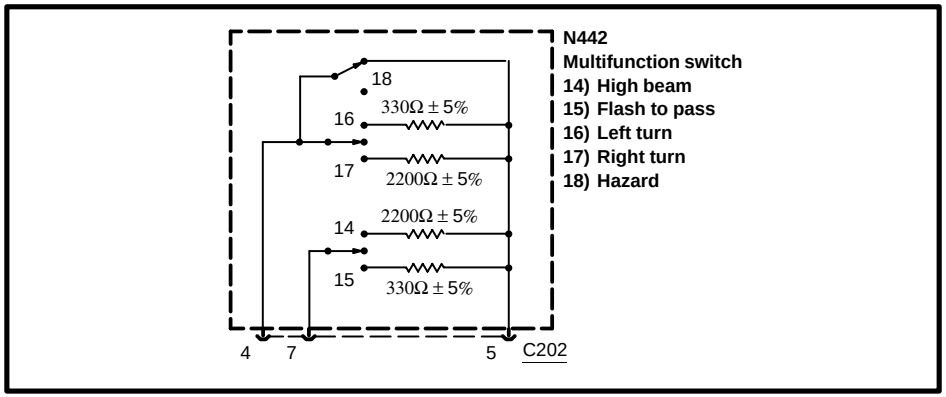

Terminals

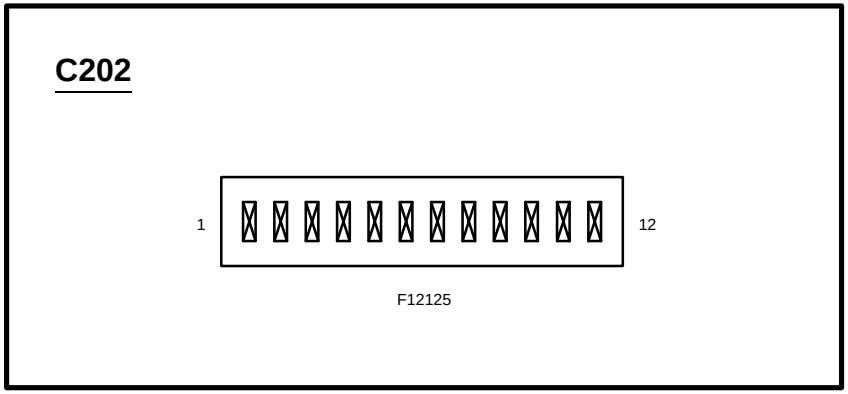

Component testing procedure

Circuit to test	Connect self–powered test light or ohmmeter to terminals	Move switch to these positions	A good switch will indicate
High Beam/Flash–to–Pass	5 and 7	High beams	2200Ω
		Neutral	Open circuit
		Flash–to–pass	330Ω
Hazard	5 and 4	Turn signal switch in neutral, Hazard On	Closed circuit
		Turn signal switch in neutral, Hazard Off	Open circuit
Turn signals	5 and 4	Left turn	330Ω
		Neutral	Open circuit
		Right turn	2200Ω