TERMINALS

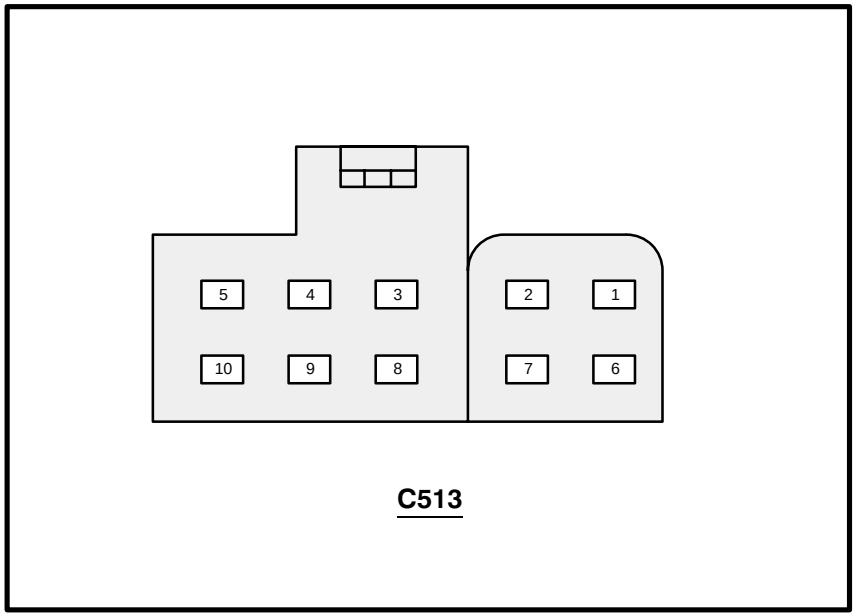

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Light or Ohmmeter to Terminals	Move Switches to These Positions	A Good Switch Will Indicate
Left Mirror		Selector Switch Left	
Up	7 and 10 2 and 3	Up	Closed Circuit Closed Circuit
Down	7 and 3 2 and 10	Down	Closed Circuit Closed Circuit
Left	7 and 4 2 and 3	Left	Closed Circuit Closed Circuit
Right	7 and 3 2 and 4	Right	Closed Circuit Closed Circuit
Right Mirror		Selector Switch Right	
Up	7 and 9 2 and 3	Up	Closed Circuit Closed Circuit
Down	7 and 3 2 and 9	Down	Closed Circuit Closed Circuit
Left	7 and 5 2 and 3	Left	Closed Circuit Closed Circuit
Right	7 and 3 2 and 5	Right	Closed Circuit Closed Circuit
Folding Mirrors		Selector Switch In/Out	
Fold In	7 and 1 2 and 6	In	Closed Circuit Closed Circuit
Fold Out	7 and 6 2 and 1	Out	Closed Circuit Closed Circuit
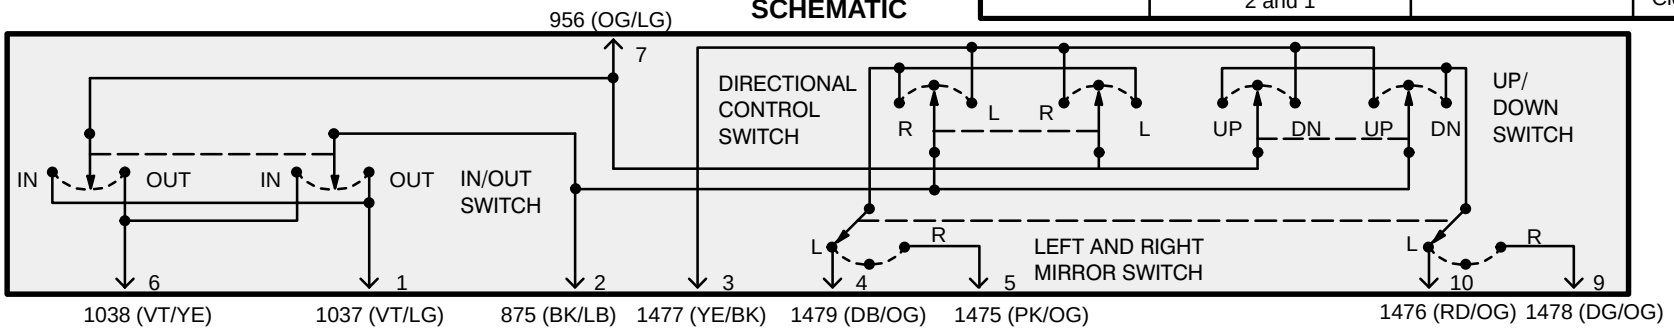
SCHEMATIC