C142 (BU)

15525

Heated Oxygen Sensor (HO2S) #12 (9G444)

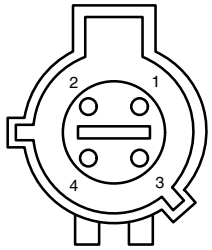

F04082

Pin	Circuit	Circuit function
1	1138 (VT/WH)	Voltage supplied in Start and Run (overload protected)
2	389 (WH/BK)	Heated Oxygen Sensor (HO2S) #12 (9G444), heater
3	359 (GY/RD)	signal, return
4	392 (RD/LG)	Heated Oxygen Sensor (HO2S) #12 (9G444), input

C143 (BK)

15525

Turbine Shaft Speed (TSS) sensor

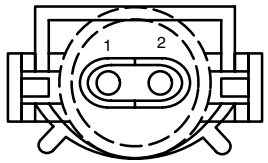

F02031

Pin	Circuit	Circuit function
1	971 (PK/BK)	Sensor signal return (reference/ground)
2	970 (DG/WH)	Turbine Shaft Speed (TSS) sensor

C144 (BK)

12B637

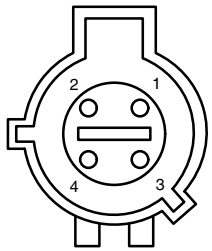

F04082

14B102

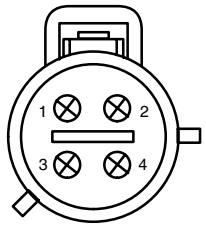

F04263

(1) 1102 (YE/LG)
(2) –
(3) –
(4) 359 (GY/RD)

C145 (BK)

* Early production

12A581

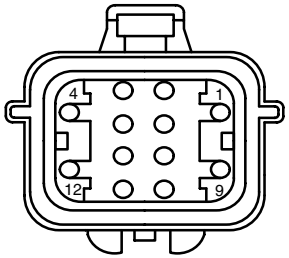

F12062

12B637

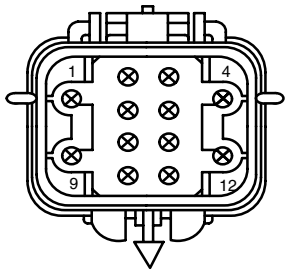

F12060

(1) 16 (RD/LG)
(2) –
(3) 361 (RD)
(4) 391 (RD/YE)
(5) *1929 (GY/YE)
(6) *328 (YE/LG)
(7) 321 (GY/WH)
(8) 48 (BK)
(9) –
(10) 743 (GY)
(11) 31 (WH/RD)
(12) 57 (BK)